

Canora Hospital			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
C		Crawlspace	Sample	B51-ASB.21	09-Aug-12		None	Debris			Crawlspace- Debris 50' in from crawlspace entry	Transite Pipe, Duct Expansion Gasket			No asbestos detected. No action required.	
C		Crawlspace	Sample	B51-ASB.22	09-Aug-12		None	Pipeline Fitting Compound			Crawlspace- Pipe fitting on small black line, 20' from north wall, 10' from west wall	Transite Pipe, Duct Expansion Gasket			No asbestos detected. No action required.	
C		Crawlspace	Sample	B51-ASB.27	17-Sep-12	Chrysotile	70%	Duct Expansion Gasket	Good	3	Crawlspace- Duct expansion gasket from ducting labelled "exhaust 1/E"	Transite Pipe, Duct Expansion Gasket	Low	Manage	Duct expansion gasket was identified within the crawlspace. The gasket was observed in good condition and should be managed in place until renovations warrant removal.	
C		Crawlspace	Sample	B51-ASB.28	17-Sep-12		None	Pipeline Fitting Compound			Crawlspace- Pipeline fitting on medium line, 10' from north wall, in middle of crawlspace	Transite Pipe, Duct Expansion Gasket			No asbestos detected. No action required.	
C		Crawlspace	Sample Rep	B51-ASB.17	09-Aug-12	Chrysotile	30%	Transite Pipe	Good	3	200 Wing Storage Room- Transite pipe	Transite Pipe, Duct Expansion Gasket	Low	Manage	Transite pipe was identified within the crawl space. The transite pipe was observed in good condition and should be managed in place.	
B		Boiler Room	Sample	B51-ASB.1	09-Aug-12	Chrysotile	50%	Pipeline Fitting Compound	Good	3	Boiler Room- Pipeline fitting on small line, above "C.W.R" plastic line, adjacent fan unit	Pipeline Fitting Compound, Mud Compound, Gasket Material	Low	Manage	Asbestos-containing fittings were identified in the boiler room. In general, these fittings were observed in good condition. It is our recommendation that these fittings be managed in place.	
B		Boiler Room	Sample	B51-ASB.2	09-Aug-12	Chrysotile	70%	Mud Compound	Poor	1	Boiler Room- Mud compound from ducting canvass, adjacent diesel room	Pipeline Fitting Compound, Mud Compound, Gasket Material	Mod/High	Repair/Remove	Repair canvass or remove mud compound where canvass is damaged and mud is exposed on ducting, adjacent diesel room entry door.	
B		Boiler Room	Sample	B51-ASB.3	09-Aug-12	Chrysotile	25%	Pipeline Fitting Compound	Good	3	Boiler Room- Pipeline fitting on medium line, coming off of "4-S" fan unit, adjacent blue electrical box	Pipeline Fitting Compound, Mud Compound, Gasket Material	Low	Manage	Asbestos-containing fittings were identified in the boiler room. In general, these fittings were observed in good condition. It is our recommendation that these fittings be managed in place.	
B		Boiler Room	Sample	B51-ASB.4	09-Aug-12		None	Duct Expansion Gasket			Boiler Room- Duct expansion gasket from "supply fan unit 4-S", adjacent diesel room	Pipeline Fitting Compound, Mud Compound, Gasket Material			No asbestos detected. No action required.	
B		Boiler Room	Sample	B51-ASB.5	09-Aug-12	Chrysotile	20%	Pipeline Fitting Compound	Poor	1	Boiler Room- Pipe fitting on medium line along east wall, adjacent air conditioner, adjacent water softener tanks	Pipeline Fitting Compound, Mud Compound, Gasket Material	Moderate	Repair/Remove	Repair/ Remove damaged fittings adjacent to the east wall, between air conditioner unit and water softener tanks.	

Canora Hospital			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
B		Boiler Room	Sample	B51-ASB.6	09-Aug-12		None	Mud Compound			Boiler Room- Mud compound from boiler exhaust off of boiler #2	Pipeline Fitting Compound, Mud Compound, Gasket Material			No asbestos detected. No action required.	
B		Boiler Room	Sample	B51-ASB.7	09-Aug-12	Chrysotile	80%	Gasket Material	Good	3	Boiler Room- Boiler Gasket	Pipeline Fitting Compound, Mud Compound, Gasket Material	Low	Manage	Boiler gasket was not marked on the boilers but was found on boiler 1 & 2. The gasket material was in good condition and should be managed in place.	
B		Boiler Room	Sample	B51-ASB.8	09-Aug-12	Chrysotile	60%	Mud Compound	Poor	1	Boiler Room- Mud compound from boiler breaching off of boiler #1	Pipeline Fitting Compound, Mud Compound, Gasket Material	Moderate	Repair	Repair damaged canvass where mud is exposed on boiler "1" exhaust.	
B		Boiler Room	Sample	B51-ASB.9	09-Aug-12	Chrysotile	15%	Pipeline Fitting Compound	Poor	1	Boiler Room- Pipe fitting on medium line painted red, with a #8 written on the fitting, adjacent water softener tanks	Pipeline Fitting Compound, Mud Compound, Gasket Material	Moderate	Repair	Repair mud compound at valve close to east wall, above silver boiler in the south east corner.	
B		Boiler Room	Sample	B51-ASB.10	09-Aug-12	Chrysotile	20%	Pipeline Fitting Compound	Poor	1	Boiler Room- Damaged pipe fitting on small red line, adjacent water softener tanks	Pipeline Fitting Compound, Mud Compound, Gasket Material	Moderate	Repair/ Remove	Repair/ Remove 2 damaged fittings coming off of header above boiler "1".	
B		Diesel Room	Sample	B51-ASB.23	17-Sep-12	Chrysotile	10%	Pipeline Fitting Compound	Good	3	Diesel Room- Pipeline fitting on small line near ceiling	Pipeline Fitting Compound	Low	Manage	Asbestos-containing fittings were identified in the diesel room. In general, these fittings were observed in good condition. It is our recommendation that these fittings be managed in place.	
B		Tool Room	Sample	B51-ASB.11	09-Aug-12	Chrysotile	70%	Gasket Material	Good	2	Tool Room- Gasket material found below ducting	Pipeline Fitting Compound, Gasket Material	Moderate	Remove	Dispose of circular gasket material hanging on hook below ducting.	
B		Tool Room	Sample	B51-ASB.12	09-Aug-12	Chrysotile	50%	Pipeline Fitting Compound	Moderate	2	Tool Room- Pipe fitting on small line along east wall, close to the ceiling, adjacent fan unit	Pipeline Fitting Compound, Gasket Material	Mod/ Low	Repair/ Remove	Repair canvass or remove pipe fitting on small line along east wall, close to ceiling, adjacent ducting. Repair/ Remove 6 damaged pipe fittings throughout the tool room.	
B		Tool Room	Sample	B51-ASB.13	09-Aug-12		None	Debris			Tool Room- Debris found below ducting	Pipeline Fitting Compound, Gasket Material			No asbestos detected. No action required.	
B		Tool Room	Sample	B51-ASB.14	09-Aug-12		None	Gasket Material			Tool Room- Duct expansion gasket from ducting	Pipeline Fitting Compound, Gasket Material			No asbestos detected. No action required.	
B		Maintenance Office Bathroom	Sample	B51-ASB.20	09-Aug-12		None	Pipeline Fitting Compound			Maintenance Office Bathroom- Pipe fitting on small line, above sink	No Accessible ACM			No action required. No accessible asbestos-containing materials identified. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.	

Canora Hospital			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
M		Public Health- Clinic Room	Sample Rep	B51-ASB.19	09-Aug-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	House Keeping Office- 9" by 9" floor tile, gray with white streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the clinic room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Public Health- Storage Room	Sample Rep	B51-ASB.19	09-Aug-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	House Keeping Office- 9" by 9" floor tile, gray with white streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the storage room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Administration	Sample Rep	B51-ASB.24	17-Sep-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Female Locker Room- 9" by 9" floor tile, cream colour with black streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the administration area. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Health Services Manager Office	Sample Rep	B51-ASB.24	17-Sep-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Female Locker Room- 9" by 9" floor tile, cream colour with black streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the office. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Administration Closet	Sample Rep	B51-ASB.24	17-Sep-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Female Locker Room- 9" by 9" floor tile, cream colour with black streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the closet. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Administration Offices	Sample Rep	B51-ASB.24	17-Sep-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Female Locker Room- 9" by 9" floor tile, cream colour with black streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the office. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		"Library" Office	Sample Rep	B51-ASB.15	09-Aug-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	200 Wing Storage Room- 9" by 9" floor tile, brown with black and white spec	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the office. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Office between Kitchen & Dining Corridor and Public Area Corridor	Sample Rep	B51-ASB.15	09-Aug-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	200 Wing Storage Room- 9" by 9" floor tile, brown with black and white spec	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the office. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Board Room Corridor	Sample	B51-ASB.25	17-Sep-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Board Room Corridor- 9" by 9" floor tile, dark green with white streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the corridor. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Board Room	Sample Rep	B51-ASB.25	17-Sep-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Board Room Corridor- 9" by 9" floor tile, dark green with white streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the board room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Washroom adjacent Board Room	Sample Rep	B51-ASB.25	17-Sep-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Board Room Corridor- 9" by 9" floor tile, dark green with white streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the washroom. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	

Canora Hospital			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
M		Female Locker Room	Sample	B51-ASB.24	17-Sep-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Female Locker Room- 9" by 9" floor tile, cream colour with black streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the locker room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Female Locker Room Washroom	Sample Rep	B51-ASB.19	09-Aug-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	House Keeping Office- 9" by 9" floor tile, gray with white streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the washroom. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		House Keeping Office	Sample	B51-ASB.19	09-Aug-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	House Keeping Office- 9" by 9" floor tile, gray with white streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the office. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		General Storage Room	Sample Rep	B51-ASB.17	09-Aug-12	Chrysotile	30%	Transite Pipe	Good	3	200 Wing Storage Room- Transite pipe	Transite Pipe	Low	Manage	Transite pipe was identified within the storage room. The transite pipe was observed in good condition and should be managed in place.	
M		X-Ray Storage Room	Sample Rep	B51-ASB.17	09-Aug-12	Chrysotile	30%	Transite Pipe	Good	3	200 Wing Storage Room- Transite pipe	Transite Pipe	Low	Manage	Transite pipe was identified within the storage room. The transite pipe was observed in good condition and should be managed in place.	
M		300 Wing Corridor	Sample Rep	B51-ASB.17	09-Aug-12	Chrysotile	30%	Transite Pipe	Good	3	200 Wing Storage Room- Transite pipe	Transite Pipe	Low	Manage	Transite Pipe was found in the wall cavity adjacent the soiled utility room.	
M		200 Wing Corridor	Sample	B51-ASB.18	09-Aug-12		None	Ceiling Tiles			200 Wing Corridor- 2' by 2' ceiling tile with pin holes	Transite Pipe			No asbestos detected. No action required.	
M		200 Wing Corridor	Sample Rep	B51-ASB.17	09-Aug-12	Chrysotile	30%	Transite Pipe	Good	3	200 Wing Storage Room- Transite pipe	Transite Pipe	Low	Manage	Transite pipe was identified within the corridor. The transite pipe was observed in good condition and should be managed in place.	
M		200 Wing Storage Room	Sample	B51-ASB.15	09-Aug-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	200 Wing Storage Room- 9" by 9" floor tile, brown with black and white spec	Transite Pipe, Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the storage room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		200 Wing Storage Room	Sample	B51-ASB.16	09-Aug-12		None	Duct Expansion Gasket			200 Wing Storage Room- Duct expansion gasket	Transite Pipe, Vinyl Asbestos Tile			No asbestos detected. No action required.	
M		200 Wing Storage Room	Sample	B51-ASB.17	09-Aug-12	Chrysotile	30%	Transite Pipe	Good	3	200 Wing Storage Room- Transite pipe	Transite Pipe, Vinyl Asbestos Tile	Low	Manage	Transite pipe was identified within the storage room. The transite pipe was observed in good condition and should be managed in place.	

Canora Hospital			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
M		X-Ray Office and Viewing	Sample Rep	B51-ASB.24	17-Sep-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Female Locker Room- 9" by 9" floor tile, cream colour with black streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the X-Ray Office and Viewing. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		"Doctors" Room	Sample Rep	B51-ASB.24	17-Sep-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Female Locker Room- 9" by 9" floor tile, cream colour with black streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the "Doctors" room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Medical Records Office	Sample Rep	B51-ASB.24	17-Sep-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Female Locker Room- 9" by 9" floor tile, cream colour with black streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the office. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Medical Records Office	Sample	B51-ASB.26	17-Sep-12		None	Insulation Material			Medical Records Office- White insulation type material from above ceiling tile	Vinyl Asbestos Tile			No asbestos detected. No action required.	
M		Dictating Office	Sample Rep	B51-ASB.24	17-Sep-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Female Locker Room- 9" by 9" floor tile, cream colour with black streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the office. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Stores Office	Sample Rep	B51-ASB.24	17-Sep-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Female Locker Room- 9" by 9" floor tile, cream colour with black streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the office. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	