

Centennial Care Home			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
C		Crawlspace	Sample	B51-ASB.13	02-Aug-12	Chrysotile	15%	Pipeline Fitting Compound	Poor	1	West Crawlspace- Damaged pipe fitting on small foil wrapped line adjacent crawlspace entry door	Pipeline Fitting Compound	Mod/High	Cleanup/Manage	Clean up debris below ducting in the middle of the west crawlspace, half way towards the far wall.	
C		Crawlspace	Sample	B51-ASB.14	02-Aug-12	Chrysotile	30%	Pipeline Fitting Compound	Poor	1	South Crawlspace- Pipe fitting on small white line 2' west of crawlspace entry door	Pipeline Fitting Compound	Mod/High	Cleanup/Manage	Clean up debris and remove damaged fitting in the North, South, and West crawlspaces, at pipe penetrations going up into resident rooms around the exterior walls. Give the ground a gentle racking within a 5' radius of the exterior walls to rid the area of ACM debris..	
C		Crawlspace	Sample	B51-ASB.15	02-Aug-12	Chrysotile	25%	Pipeline Fitting Compound	Poor	1	North Crawlspace- Pipe fitting on small white line 8' from crawlspace entry door, adjacent ducting	Pipeline Fitting Compound	Mod/High	Cleanup/Manage	Due to the amount of debris within the North, South, and West crawl spaces, it is recommended that any worker needing to enter those crawlspaces do so wearing a hepa filtered respirator and disposable coveralls.	
C		Crawlspace	Sample	B51-ASB.16	02-Aug-12		None	Debris			North Crawlspace- Debris laying on ground 8' from crawlspace entry, below piping	Pipeline Fitting Compound			No asbestos detected. No action required.	
C		Crawlspace	Sample	B51-ASB.22	02-Aug-12		None	Pipeline Fitting Compound			South Crawlspace Addition- Pipe fitting on small line, adjacent trap entry door	Pipeline Fitting Compound			No asbestos detected. No action required.	
C		Crawlspace	Sample	B51-ASB.24	02-Aug-12		None	Pipeline Fitting Compound			Kitchen Crawlspace- Pipe fitting on medium line adjacent trap entry door	Pipeline Fitting Compound			No asbestos detected. No action required.	
C		Crawlspace	Sample	B51-ASB.27	02-Aug-12		None	Pipeline Fitting Compound			North Crawlspace Addition- Pipe fitting on small line adjacent trap entry door	Pipeline Fitting Compound			No asbestos detected. No action required.	
B		Boiler Room	Sample	B51-ASB.1	02-Aug-12	Chrysotile	20%	Pipeline Fitting Compound	Good	3	Boiler Room- Pipe fitting on large line, at waist height, coming off of "P1" motor, adjacent entry door	Pipeline Fitting Compound	Low	Manage	Asbestos-containing fittings were identified in the boiler room. In general, these fittings were observed in good condition. It is our recommendation that these fittings be managed in place.	
B		Boiler Room	Sample	B51-ASB.2	02-Aug-12	Chrysotile	10%	Pipeline Fitting Compound	Good	3	Boiler Room- Pipe fitting on medium white line, above blue "Filterite" filter, adjacent entry door	Pipeline Fitting Compound	Low	Manage	Asbestos-containing fittings were identified in the boiler room. In general, these fittings were observed in good condition. It is our recommendation that these fittings be managed in place.	
B		Boiler Room	Sample	B51-ASB.3	02-Aug-12	Chrysotile	15%	Pipeline Fitting Compound	Good	3	Boiler Room- Pipe fitting on medium old brown line overhead adjacent orange "DHW Boiler 1"	Pipeline Fitting Compound	Low	Manage	Asbestos-containing fittings were identified in the boiler room. In general, these fittings were observed in good condition. It is our recommendation that these fittings be managed in place.	
B		Boiler Room	Sample	B51-ASB.4	02-Aug-12		None	Mud compound			Boiler Room- Boiler breaching from blue boiler #2	Pipeline Fitting Compound			No asbestos detected. No action required.	
B		Boiler Room	Sample	B51-ASB.5	02-Aug-12	Chrysotile	15%	Pipeline Fitting Compound	Good	3	Boiler Room- Pipe fitting on damaged small old brown line overhead adjacent south water tank	Pipeline Fitting Compound	Low	Manage	Asbestos-containing fittings were identified in the boiler room. In general, these fittings were observed in good condition. It is our recommendation that these fittings be managed in place.	

Centennial Care Home			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
B		Corridor	Sample Rep	B51-ASB.12	02-Aug-12	Chrysotile	20%	Pipeline Fitting Compound	Good	3	Basement Washroom- Pipe fitting on small white line along east wall, adjacent unit heater	Pipeline Fitting Compound	Low	Manage	Asbestos-containing fittings were identified in the corridor. In general, these fittings were observed in good condition. It is our recommendation that these fittings be managed in place.	
B		Supply Storage Room	Sample	B51-ASB.6	02-Aug-12	Chrysotile	10%	Pipeline Fitting Compound	Good	3	Basement Supply Storage Room- Pipe fitting on small white line, adjacent ceiling, adjacent hole in the ceiling	Pipeline Fitting Compound, Vinyl Floor Tile	Low	Manage	Asbestos-containing fittings were identified in the supply storage room. In general, these fittings were observed in good condition. It is our recommendation that these fittings be managed in place.	
B		Supply Storage Room	Sample	B51-ASB.7	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Supply Storage Room- 12" by 12" floor tile, light brown with dark brown spec	Pipeline Fitting Compound, Vinyl Floor Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the supply storage room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
B		Supply Storage Room	Sample	B51-ASB.8	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Supply Storage Room- 12" by 12" floor tile, pink with blue, red, and white spec	Pipeline Fitting Compound, Vinyl Floor Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the supply storage room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
B		Storage Room adjacent Supply Storage Room	Sample	B51-ASB.9	02-Aug-12	Chrysotile	15%	Pipeline Fitting Compound	Good	3	Storage Room adjacent Basement Supply Storage Room- Pipe fitting on medium white line, overhead, adjacent red motor	Pipeline Fitting Compound, Vinyl Floor Tile	Low	Manage	Asbestos-containing fittings were identified in the storage room. In general, these fittings were observed in good condition. It is our recommendation that these fittings be managed in place.	
B		Storage Room adjacent Supply Storage Room	Sample	B51-ASB.21	02-Aug-12	Chrysotile	10%	Pipeline Fitting Compound	Good	3	Basement Storage Room adjacent Supply Room- Pipe fitting on small white line overhead in the corner of room	Pipeline Fitting Compound, Vinyl Floor Tile	Low	Manage	Asbestos-containing fittings were identified in the boiler room. In general, these fittings were observed in good condition. It is our recommendation that these fittings be managed in place.	
B		Storage Room adjacent Supply Storage Room	Sample Rep	B51-ASB.7	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Supply Storage Room- 12" by 12" floor tile, light brown with dark brown spec	Pipeline Fitting Compound, Vinyl Floor Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the storage room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
B		Maintenance Office	Sample	B51-ASB.10	02-Aug-12	Chrysotile	20%	Pipeline Fitting Compound	Good	3	Basement Maintenance Office- Pipe fitting on small green overhead "Dom. Hot" line, adjacent entry door	Pipeline Fitting Compound	Low	Manage	Asbestos-containing fittings were identified in the maintenance office. In general, these fittings were observed in good condition. It is our recommendation that these fittings be managed in place.	
B		House Keeping Supplies Room	Sample	B51-ASB.11	02-Aug-12	Chrysotile	15%	Pipeline Fitting Compound	Good	3	Basement House Keeping Supplies- Pipe fitting on medium overhead line adjacent east shelving unit	Pipeline Fitting Compound	Low	Manage	Asbestos-containing fittings were identified in the house keeping supplies room. In general, these fittings were observed in good condition. It is our recommendation that these fittings be managed in place.	
B		Office Supplies and Activity Supplies Room	Sample Rep	B51-ASB.11	02-Aug-12	Chrysotile	15%	Pipeline Fitting Compound	Good	3	Basement House Keeping Supplies- Pipe fitting on medium overhead line adjacent east shelving unit	Pipeline Fitting Compound	Low	Manage	Asbestos-containing fittings were identified in the office supplies and activity supplies room. In general, these fittings were observed in good condition. It is our recommendation that these fittings be managed in place.	

Centennial Care Home			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
B		Washroom	Sample	B51-ASB.12	02-Aug-12	Chrysotile	20%	Pipeline Fitting Compound	Good	3	Basement Washroom- Pipe fitting on small white line along east wall, adjacent unit heater	Pipeline Fitting Compound	Low	Manage	Asbestos-containing fittings were identified in the washroom. In general, these fittings were observed in good condition. It is our recommendation that these fittings be managed in place.	
B		Storage Room adjacent Washroom	Sample Rep	B51-ASB.11	02-Aug-12	Chrysotile	15%	Pipeline Fitting Compound	Good	3	Basement House Keeping Supplies- Pipe fitting on medium overhead line adjacent east shelving unit	Pipeline Fitting Compound	Low	Manage	Asbestos-containing fittings were identified in the storage room. In general, these fittings were observed in good condition. It is our recommendation that these fittings be managed in place.	
B		West Basement Stairwell	Sample Rep	B51-ASB.7	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Supply Storage Room- 12" by 12" floor tile, light brown with dark brown spec	Vinyl Floor Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the stairwell. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1		Chapel Road North Corridor	Sample	B51-ASB.17	02-Aug-12	Actinolite/ Tremolite	>0.1%	Insulation Material	Good	3	Chapel Road North Corridor- Vermiculite insulation from ceiling space adjacent health services manager office	Insulation Material, Vinyl Floor Tile	Moderate	Manage	Zonelite insulation was found above the ceiling tile adjacent the general meeting room. This was the only place that the insulation was identified but is believed to be in enclosed areas of the facility.	
1		Chapel Road North Corridor	Sample Rep	B51-ASB.7	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Supply Storage Room- 12" by 12" floor tile, light brown with dark brown spec	Insulation Material, Vinyl Floor Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the corridor. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1		Westview Lane Corridor	Sample	B51-ASB.18	02-Aug-12		None	Ceiling Tiles			Westview Lane Corridor- 2' by 4' ceiling tile, with tiny and small pin holes and a rough surface	Vinyl Floor Tile			No asbestos detected. No action required.	
1		Westview Lane Corridor	Sample Rep	B51-ASB.7	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Supply Storage Room- 12" by 12" floor tile, light brown with dark brown spec	Vinyl Floor Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the corridor. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1		Sunnyside Lane Corridor	Sample	B51-ASB.19	02-Aug-12		None	Vinyl Sheet Flooring			Sunnyside Lane Corridor- Sheet flooring, three toned brown stone pattern	Vinyl Floor Tile			No asbestos detected. No action required.	
1		Sunnyside Lane Corridor	Sample Rep	B51-ASB.7	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Supply Storage Room- 12" by 12" floor tile, light brown with dark brown spec	Vinyl Floor Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the corridor. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1		Main Foyer	Sample	B51-ASB.20	02-Aug-12		None	Ceiling Tiles			Main Foyer- 2' by 4' ceiling tile, with tiny and small pin holes	No accessible ACM			No action required. No accessible asbestos-containing materials identified. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.	
1		Soiled Linen Room	Sample Rep	B51-ASB.7	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Supply Storage Room- 12" by 12" floor tile, light brown with dark brown spec	Vinyl Floor Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the soiled linen room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1		Med Room	Sample Rep	B51-ASB.7	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Supply Storage Room- 12" by 12" floor tile, light brown with dark brown spec	Vinyl Floor Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the med room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	

Centennial Care Home			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
1		General Meeting Room	Sample Rep	B51-ASB.7	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Supply Storage Room-12" by 12" floor tile, light brown with dark brown spec	Vinyl Floor Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the general meeting room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1		Health Services Administrator Office	Sample Rep	B51-ASB.7	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Supply Storage Room-12" by 12" floor tile, light brown with dark brown spec	Vinyl Floor Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the office. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1		Manager of Operational Support Services Office	Sample Rep	B51-ASB.7	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Supply Storage Room-12" by 12" floor tile, light brown with dark brown spec	Vinyl Floor Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the office. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1		Storage Room adjacent Nurse Station	Sample Rep	B51-ASB.7	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Supply Storage Room-12" by 12" floor tile, light brown with dark brown spec	Vinyl Floor Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the storage room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1		Kitchen Storage Room	Sample	B51-ASB.23	02-Aug-12	None		Pipeline Fitting Compound			Kitchen Storage Room- Pipe fitting on small white line, overhead, adjacent heating unit	No accessible ACM			No action required. No accessible asbestos-containing materials identified. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.	
1		Electrical Room adjacent Kitchen	Sample	B51-ASB.25	02-Aug-12	None		Pipeline Fitting Compound			Electrical Room adjacent Kitchen- Pipe fitting on small line adjacent to wall	No accessible ACM			No action required. No accessible asbestos-containing materials identified. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.	
1		Hair Salon	Sample	B51-ASB.26	02-Aug-12	None		Vinyl Sheet Flooring			Hair Salon- Sheet flooring dark and light large rectangular pattern	No accessible ACM			No action required. No accessible asbestos-containing materials identified. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.	
1	1	Resident Room	Sample Rep	B51-ASB.7	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Supply Storage Room-12" by 12" floor tile, light brown with dark brown spec	Vinyl Floor Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1	2	Resident Room	Sample Rep	B51-ASB.7	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Supply Storage Room-12" by 12" floor tile, light brown with dark brown spec	Vinyl Floor Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1	3	Resident Room	Sample Rep	B51-ASB.7	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Supply Storage Room-12" by 12" floor tile, light brown with dark brown spec	Vinyl Floor Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1	4	Resident Room	Sample Rep	B51-ASB.7	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Supply Storage Room-12" by 12" floor tile, light brown with dark brown spec	Vinyl Floor Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	

Centennial Care Home			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
1	5	Resident Room	Sample Rep	B51-ASB.7	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Supply Storage Room-12" by 12" floor tile, light brown with dark brown spec	Vinyl Floor Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1	6	Resident Room	Sample Rep	B51-ASB.7	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Supply Storage Room-12" by 12" floor tile, light brown with dark brown spec	Vinyl Floor Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1	7	Resident Room	Sample Rep	B51-ASB.7	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Supply Storage Room-12" by 12" floor tile, light brown with dark brown spec	Vinyl Floor Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1	8	Resident Room	Sample Rep	B51-ASB.7	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Supply Storage Room-12" by 12" floor tile, light brown with dark brown spec	Vinyl Floor Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1	15	Resident Room	Sample Rep	B51-ASB.7	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Supply Storage Room-12" by 12" floor tile, light brown with dark brown spec	Vinyl Floor Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1	16	Resident Room	Sample Rep	B51-ASB.7	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Supply Storage Room-12" by 12" floor tile, light brown with dark brown spec	Vinyl Floor Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1	17	Resident Room	Sample Rep	B51-ASB.7	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Supply Storage Room-12" by 12" floor tile, light brown with dark brown spec	Vinyl Floor Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1	18	Resident Room	Sample Rep	B51-ASB.7	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Supply Storage Room-12" by 12" floor tile, light brown with dark brown spec	Vinyl Floor Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1	19	Resident Room	Sample Rep	B51-ASB.7	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Supply Storage Room-12" by 12" floor tile, light brown with dark brown spec	Vinyl Floor Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1	20	Resident Room	Sample Rep	B51-ASB.7	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Supply Storage Room-12" by 12" floor tile, light brown with dark brown spec	Vinyl Floor Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1	21	Resident Room	Sample Rep	B51-ASB.7	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Supply Storage Room-12" by 12" floor tile, light brown with dark brown spec	Vinyl Floor Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	

Centennial Care Home			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
1	22	Resident Room	Sample Rep	B51-ASB.7	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Supply Storage Room-12" by 12" floor tile, light brown with dark brown spec	Vinyl Floor Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1	23	Resident Room	Sample Rep	B51-ASB.7	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Supply Storage Room-12" by 12" floor tile, light brown with dark brown spec	Vinyl Floor Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1	24	Resident Room	Sample Rep	B51-ASB.7	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Supply Storage Room-12" by 12" floor tile, light brown with dark brown spec	Vinyl Floor Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1	25	Resident Room	Sample Rep	B51-ASB.7	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Supply Storage Room-12" by 12" floor tile, light brown with dark brown spec	Vinyl Floor Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1	26	Resident Room	Sample Rep	B51-ASB.7	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Supply Storage Room-12" by 12" floor tile, light brown with dark brown spec	Vinyl Floor Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1	27	Resident Room	Sample Rep	B51-ASB.7	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Supply Storage Room-12" by 12" floor tile, light brown with dark brown spec	Vinyl Floor Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1	36	Resident Room	Sample Rep	B51-ASB.7	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Supply Storage Room-12" by 12" floor tile, light brown with dark brown spec	Vinyl Floor Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1	37	Resident Room	Sample Rep	B51-ASB.7	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Supply Storage Room-12" by 12" floor tile, light brown with dark brown spec	Vinyl Floor Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1	39	Resident Room	Sample Rep	B51-ASB.7	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Supply Storage Room-12" by 12" floor tile, light brown with dark brown spec	Vinyl Floor Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1	40	Resident Room	Sample Rep	B51-ASB.7	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Supply Storage Room-12" by 12" floor tile, light brown with dark brown spec	Vinyl Floor Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1	41	Resident Room	Sample Rep	B51-ASB.7	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Supply Storage Room-12" by 12" floor tile, light brown with dark brown spec	Vinyl Floor Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	

Centennial Care Home			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
1	42	Resident Room	Sample Rep	B51-ASB.7	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Supply Storage Room-12" by 12" floor tile, light brown with dark brown spec	Vinyl Floor Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1	43	Resident Room	Sample Rep	B51-ASB.7	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Supply Storage Room-12" by 12" floor tile, light brown with dark brown spec	Vinyl Floor Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1	44	Resident Room	Sample Rep	B51-ASB.7	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Supply Storage Room-12" by 12" floor tile, light brown with dark brown spec	Vinyl Floor Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1	45	Resident Room	Sample Rep	B51-ASB.7	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Supply Storage Room-12" by 12" floor tile, light brown with dark brown spec	Vinyl Floor Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1	46	Resident Room	Sample Rep	B51-ASB.7	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Supply Storage Room-12" by 12" floor tile, light brown with dark brown spec	Vinyl Floor Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1	47	Resident Room	Sample Rep	B51-ASB.7	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Supply Storage Room-12" by 12" floor tile, light brown with dark brown spec	Vinyl Floor Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1	48	Resident Room	Sample Rep	B51-ASB.7	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Supply Storage Room-12" by 12" floor tile, light brown with dark brown spec	Vinyl Floor Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1	49	Resident Room	Sample Rep	B51-ASB.7	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Supply Storage Room-12" by 12" floor tile, light brown with dark brown spec	Vinyl Floor Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1	50	Resident Room	Sample Rep	B51-ASB.7	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Supply Storage Room-12" by 12" floor tile, light brown with dark brown spec	Vinyl Floor Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1	51	Resident Room	Sample Rep	B51-ASB.7	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Supply Storage Room-12" by 12" floor tile, light brown with dark brown spec	Vinyl Floor Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1		Closet adjacent Room 51	Sample Rep	B51-ASB.7	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Supply Storage Room-12" by 12" floor tile, light brown with dark brown spec	Vinyl Floor Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	

Centennial Care Home			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
1	52	Resident Room	Sample Rep	B51-ASB.7	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Supply Storage Room-12" by 12" floor tile, light brown with dark brown spec	Vinyl Floor Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the closet. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1	53	Resident Room	Sample Rep	B51-ASB.7	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Supply Storage Room-12" by 12" floor tile, light brown with dark brown spec	Vinyl Floor Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1	54	Resident Room	Sample Rep	B51-ASB.7	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Supply Storage Room-12" by 12" floor tile, light brown with dark brown spec	Vinyl Floor Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1		Clean Linen Room adjacent Room 54	Sample Rep	B51-ASB.7	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Supply Storage Room-12" by 12" floor tile, light brown with dark brown spec	Vinyl Floor Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the clean linen room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	