

Foam Lake Jubilee Home															
			SAMPLE DATA												
Floor	Room Number	Use	SAMPLE SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments
C		Crawlspace	Sample	B51-ASB.7	02-Aug-12	Chrysotile	50%	Pipeline Fitting Compound	Poor	1	West Crawlspace- Pipe fitting on small line adjacent entry door	Pipeline Fitting Compound, Mud Compound, Transite Pipe	Mod/High	Cleanup/Manage	Asbestos Debris was identified throughout the North, East and West wing crawlspaces of the facility. It is our recommendation that the ground in the crawlspaces be substantially cleaned to remove all loose debris. A racking of the ground to may be necessary to remove all loose debris. It is recommended that personnel entering the crawlspace do so with a hepa filtered respirator and a disposable suit.
C		Crawlspace	Sample	B51-ASB.8	02-Aug-12	Chrysotile	35%	Mud Compound	Poor	1	West Crawlspace- Mud compound on black line along east wall, 20' north of entry door	Pipeline Fitting Compound, Mud Compound, Transite Pipe	Mod/High	Remove	The mud compound used on the lineal lines for insulation and on pipe elbows, for the most part are in poor condition. It is our recommendation that all the asbestos mud and pipe elbows be removed from the North, East and West crawlspaces.
C		Crawlspace	Sample	B51-ASB.9	02-Aug-12	Chrysotile	40%	Pipeline Fitting Compound	Poor	1	West Crawlspace- Pipe fitting on small line, 25' straight west of crawlspace entry door	Pipeline Fitting Compound, Mud Compound, Transite Pipe	Mod/High	Remove	Due to the amount of loose asbestos debris in the North, East and West crawlspaces, it is our recommendation that any worker working the crawlspaces prior to asbestos removal wear a hepa filtered half mask respirator and disposable coveralls.
C		Crawlspace	Sample	B51-ASB.11	02-Aug-12	Chrysotile	25%	Pipeline Fitting Compound	Poor	1	East Crawlspace- Pipe fitting on small line in the northwest corner	Pipeline Fitting Compound, Mud Compound, Transite Pipe	Mod/High	Remove	The mud compound used on the lineal lines for insulation and on pipe elbows, for the most part are in poor condition. It is our recommendation that all the asbestos mud and pipe elbows be removed from the North, East and West crawlspaces.
C		Crawlspace	Sample	B51-ASB.19	02-Aug-12	Chrysotile	30%	Transite Pipe	Good	3	Crawlspace- Transite pipe	Pipeline Fitting Compound, Mud Compound, Transite Pipe	Low	Manage	Transite pipe was found at the far west end of the west crawl space in one area coming out of the dirt, although it is believed to be in other areas as well but never identified. It is our recommendation that the transite pipe be managed in place.
B		Boiler Room	Sample	B51-ASB.1	02-Aug-12		None	Pipeline Fitting Compound			Boiler Room- Pipe fitting on large "37" line, coming off of "P2" red motor	Pipeline Fitting Compound, Mud Compound			No asbestos detected. No action required.
B		Boiler Room	Sample	B51-ASB.2	02-Aug-12		None	Pipeline Fitting Compound			Boiler Room- Pipe fitting on large line, coming off of "B-1" boiler, above thermometer	Pipeline Fitting Compound, Mud Compound			No asbestos detected. No action required.
B		Boiler Room	Sample	B51-ASB.3	02-Aug-12		None	Pipeline Fitting Compound			Boiler Room- Pipe fitting on large "HWS" line 5' from east wall, adjacent cement pillar, below ducting	Pipeline Fitting Compound, Mud Compound			No asbestos detected. No action required.
B		Boiler Room	Sample	B51-ASB.4	02-Aug-12	Chrysotile	20%	Pipeline Fitting Compound	Good	3	Boiler Room- Pipe fitting on small white line in the southeast corner	Pipeline Fitting Compound, Mud Compound	Low	Manage	Asbestos-containing fittings were identified in the boiler room. In general, these fittings were observed in good condition. It is our recommendation that these fittings be managed in place.
B		Boiler Room	Sample	B51-ASB.5	02-Aug-12	Chrysotile	20%	Mud Compound	Good	3	Boiler Room- Mud compound at the end of "23 Hot Water To East Wing" line, along west wall	Pipeline Fitting Compound, Mud Compound	Low	Manage	Asbestos containing mud compound was identified within the boiler room. The mud compound was observed in good condition. It is our recommendation that the mud compound be managed in place.
B		Boiler Room	Sample	B51-ASB.6	02-Aug-12		None	Fire-Stop Material			Boiler Room- Fire stop material at pipe penetration into the ceiling, between the boiler units	Pipeline Fitting Compound, Mud Compound			No asbestos detected. No action required.

Foam Lake Jubilee Home															
			SAMPLE DATA												
Floor	Room Number	Use	SAMPLE SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments
B		Boiler Room	Sample	B51-ASB.14	02-Aug-12		None	Pipeline Fitting Compound			Boiler Room- Pipe fitting on small line in the middle of room above "Trane" compressor, below white ducting	Pipeline Fitting Compound, Mud Compound			No asbestos detected. No action required.
B		Electrical Room	Sample	B51-ASB.10	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Electrical Room- 9" by 9" floor tile, white with dark gray streak	Vinyl Asbestos Floor Tile, Pipeline Fitting Compound	Low	Manage	Asbestos was detected with in the vinyl floor tile located within the electrical room . Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
B		Electrical Room	Sample	B51-ASB.18	02-Aug-12	Chrysotile	20%	Pipeline Fitting Compound	Poor	2	Electrical Room- Pipe fitting on small white line along west wall, above white ducting	Vinyl Asbestos Floor Tile, Pipeline Fitting Compound	Moderate	Cleanup/Manage	Clean up fitting debris from on top of the white ducting.
B		Corridor	Sample	B51-ASB.12	02-Aug-12		None	Ceiling Tiles			Corridor adjacent Basement Entry- 2' by 4' ceiling tile, tiny pin holes with irregular gashes	Vinyl Asbestos Floor Tile, Pipeline Fitting Compound			No asbestos detected. No action required.
B		Corridor	Sample	B51-ASB.17	02-Aug-12	Chrysotile	30%	Pipeline Fitting Compound	Good	3	Basement Corridor- Pipe fitting on small line above ceiling tile, adjacent ducting	Vinyl Asbestos Floor Tile, Pipeline Fitting Compound	Low	Manage	Asbestos-containing fittings were identified in the basement corridor. In general, these fittings were observed in good condition. It is our recommendation that these fittings be managed in place.
B		Corridor	Sample Rep	B51-ASB.10	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Electrical Room- 9" by 9" floor tile, white with dark gray streak	Vinyl Asbestos Floor Tile, Pipeline Fitting Compound	Low	Manage	Asbestos was detected with in the vinyl floor tile located within the basement corridor . Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
B		Storage Room	Sample	B51-ASB.15	02-Aug-12	Actinolite/ Tremolite	>0.1%	Insulation Material	Good	3	Basement South Storage Room- Zonelite insulation material found in hole in the roof, on top of ceiling	Insulation Material, Pipeline Fitting Compound	Low/Mod	Manage	Zonelite insulation was found between the two layers of ceiling within the room. It is our recommendation that the insulation be managed in place until future plans require a disturbance of the material.
B		Storage Room	Sample	B51-ASB.16	02-Aug-12	Chrysotile	20%	Pipeline Fitting Compound	Poor	2	Basement South Storage Room- Pipe fitting debris found on top of ceiling	Insulation Material, Pipeline Fitting Compound	Moderate	Remove	Remove all debris from on top of ceiling, that was identified through the hole in the roof.
B		B5 Storage	Sample Rep	B51-ASB.10	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Electrical Room- 9" by 9" floor tile, white with dark gray streak	Vinyl Asbestos Floor Tile	Low	Manage	Asbestos was detected with in the vinyl floor tile located within the B5 storage room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
B		Fire Alarm Panel Room	Sample Rep	B51-ASB.10	02-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Electrical Room- 9" by 9" floor tile, white with dark gray streak	Vinyl Asbestos Floor Tile	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the fire alarm panel room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
1	12	Resident Room	Sample Rep	B51-ASB.13	02-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Room 50- Sheet flooring, Light brown three toned stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
1	13	Resident Room	Sample Rep	B51-ASB.13	02-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Room 50- Sheet flooring, Light brown three toned stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.

Foam Lake Jubilee Home															
			SAMPLE DATA												
Floor	Room Number	Use	SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments
1	14	Resident Room	Sample Rep	B51-ASB.13	02-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Room 50- Sheet flooring, Light brown three toned stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
1	15	Resident Room	Sample Rep	B51-ASB.13	02-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Room 50- Sheet flooring, Light brown three toned stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
1	16	Resident Room	Sample Rep	B51-ASB.13	02-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Room 50- Sheet flooring, Light brown three toned stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
1	17	Resident Room	Sample Rep	B51-ASB.13	02-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Room 50- Sheet flooring, Light brown three toned stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
1	18	Resident Room	Sample Rep	B51-ASB.13	02-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Room 50- Sheet flooring, Light brown three toned stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
1		Entrance adjacent Room 18	Sample Rep	B51-ASB.13	02-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Room 50- Sheet flooring, Light brown three toned stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the entrance. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
1		Pioneer Room	Sample Rep	B51-ASB.13	02-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Room 50- Sheet flooring, Light brown three toned stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the pioneer room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
1		Entrance adjacent Pioneer Room	Sample Rep	B51-ASB.13	02-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Room 50- Sheet flooring, Light brown three toned stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the entrance. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
1	48	Resident Room	Sample Rep	B51-ASB.13	02-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Room 50- Sheet flooring, Light brown three toned stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
1	49	Resident Room	Sample Rep	B51-ASB.13	02-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Room 50- Sheet flooring, Light brown three toned stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
1	50	Resident Room	Sample	B51-ASB.13	02-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Room 50- Sheet flooring, Light brown three toned stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
1	51	Resident Room	Sample Rep	B51-ASB.13	02-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Room 50- Sheet flooring, Light brown three toned stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
1	52	Resident Room	Sample Rep	B51-ASB.13	02-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Room 50- Sheet flooring, Light brown three toned stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
1	53	Resident Room	Sample Rep	B51-ASB.13	02-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Room 50- Sheet flooring, Light brown three toned stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.

Foam Lake Jubilee Home															
			SAMPLE DATA												
Floor	Room Number	Use	SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments
1	54	Resident Room	Sample Rep	B51-ASB.13	02-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Room 50- Sheet flooring, Light brown three toned stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
1		Entrance adjacent Room 54	Sample Rep	B51-ASB.13	02-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Room 50- Sheet flooring, Light brown three toned stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the entrance. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
1		West Wing	Sample Rep	B51-ASB.15	02-Aug-12	Actinolite/ Tremolite	>0.1%	Insulation Material	Good	2	Basement South Storage Room- Zonelite insulation material found in hole in the roof, on top of ceiling	Insulation Material	Moderate	Cleanup/Manage	Clean up Zonelite insulation on top of ceiling tile, adjacent west wing attic access.
A		Attic	Sample Rep	B51-ASB.15	02-Aug-12	Actinolite/ Tremolite	>0.1%	Insulation Material	Good	3	Basement South Storage Room- Zonelite insulation material found in hole in the roof, on top of ceiling	Insulation Material	Low/Mod	Manage	There was a layer of zonelite insulation on top of the ceiling, it is our recommendation that the insulation be managed in place until future plans require a disturbance of the material.