

Invermay Health Centre			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
C		East Wing Crawlspace	Sample	B51-ASB.10	07-Aug-12	Chrysotile	70%	Lineal Pipe Insulation Debris	Poor	1	East Wing Crawlspace- Lineal pipe debris adjacent main desk crawl space entrance	Lineal Pipe Insulation Debris	Moderate	Cleanup/Manage	Asbestos debris was identified throughout the East Wing Crawlspace of the facility. It is our recommendation that the East Wing Crawlspace area of the facility be substantially cleaned to remove all loose debris. Minor raking of the ground may be necessary to ensure that all material has been removed. Bersch would recommend that all personnel entering the crawlspace prior to cleanup do so with a suitable respirator and disposable coveralls.	
M		East Wing Boiler Room	Sample	B51-ASB.1	07-Aug-12		None	Pipeline Fitting Compound			East Wing Boiler Room- Pipe fitting on small line, adjacent stairs	No Accessible ACM			No asbestos detected. No action required. No accessible asbestos-containing materials identified. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.	
M		East Wing Boiler Room	Sample	B51-ASB.2	07-Aug-12		None	Lineal Pipe Insulation			East Wing Boiler Room- Lineal pipe insulation on small line, adjacent water tanks	No Accessible ACM			No asbestos detected. No action required. No accessible asbestos-containing materials identified. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.	
M		Entrance adjacent East Wing Boiler Room	Sample	B51-ASB.3	07-Aug-12		None	Ceiling Tiles			Entrance adjacent East Wing Boiler Room- 12" by 12" ceiling tile, all white	No Accessible ACM			No asbestos detected. No action required. No accessible asbestos-containing materials identified. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.	
M		Entrance adjacent East Wing Boiler Room	Sample	B51-ASB.4	07-Aug-12		None	Ceiling Tiles			Entrance adjacent East Wing Boiler Room- 12" by 12" ceiling tile, all white with small holes	No Accessible ACM			No asbestos detected. No action required. No accessible asbestos-containing materials identified. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.	
M		Men's Washroom East Corridor	Sample	B51-ASB.5	07-Aug-12	Chrysotile	80%	Heat Shield Material	Good	3	Men's Washroom- Heat shield in light fixture	Heat Shield Material	Low	Manage	If Damaged, remove exposed heat shields from light fixtures.	
M		Women's Washroom East Corridor	Sample Rep	B51-ASB.5	07-Aug-12	Chrysotile	80%	Heat Shield Material	Good	3	Men's Washroom- Heat shield in light fixture	Heat Shield Material	Low	Manage	If Damaged, remove exposed heat shields from light fixtures.	
M		Linen Storage East Corridor	Sample Rep	B51-ASB.5	07-Aug-12	Chrysotile	80%	Heat Shield Material	Good	3	Men's Washroom- Heat shield in light fixture	Heat Shield Material	Low	Manage	If Damaged, remove exposed heat shields from light fixtures.	
M		Corridor	Sample	B51-ASB.6	07-Aug-12		None	Vinyl Sheet Flooring			Corridor- Sheet flooring, tiny gray and white stone pattern	No Accessible ACM			No asbestos detected. No action required. No accessible asbestos-containing materials identified. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.	
M		East Wing Front Entrance	Sample	B51-ASB.7	07-Aug-12		None	Ceiling Tiles			East Wing Front Entrance- 12" by 12" ceiling tile, with pin holes and gashes	No Accessible ACM			No asbestos detected. No action required. No accessible asbestos-containing materials identified. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.	
M		East Wing Storage Room	Sample	B51-ASB.8	07-Aug-12		None	Floor Leveller			East Wing Storage Room- Floor levelling material underneath flooring	No Accessible ACM			No asbestos detected. No action required. No accessible asbestos-containing materials identified. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.	

Invermay Health Centre			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
M		East Wing Storage Room	Sample	B51-ASB.9	07-Aug-12		None	Vinyl Sheet Flooring			East Wing Storage Room- Second layer of flooring material	No Accessible ACM			No asbestos detected. No action required. No accessible asbestos-containing materials identified. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.	
M		West Wing Boiler Room	Sample	B51-ASB.11	07-Aug-12		None	Pipeline Fitting Compound			West Wing Boiler Room- Pipe fitting on small line, adjacent boiler #1	No Accessible ACM			No asbestos detected. No action required. No accessible asbestos-containing materials identified. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.	
M		West Wing Boiler Room	Sample	B51-ASB.12	07-Aug-12		None	Pipeline Fitting Compound			West Wing Boiler Room- Damaged pipe fitting on small line, adjacent water tank	No Accessible ACM			No asbestos detected. No action required. No accessible asbestos-containing materials identified. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.	
M		West Wing Boiler Room	Sample	B51-ASB.13	07-Aug-12		None	Pipeline Fitting Compound			West Wing Boiler Room- Pipe fitting on medium line in the northwest corner	No Accessible ACM			No asbestos detected. No action required. No accessible asbestos-containing materials identified. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.	
M		West Wing Boiler Room	Sample	B51-ASB.14	07-Aug-12		None	Duct Insulation			West Wing Boiler Room- Duct insulation	No Accessible ACM			No asbestos detected. No action required. No accessible asbestos-containing materials identified. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.	
M		West Wing Main Corridor	Sample	B51-ASB.15	07-Aug-12		None	Ceiling Tiles			West Wing Main Corridor- 2' by 4' ceiling tile, with pin holes	No Accessible ACM			No asbestos detected. No action required. No accessible asbestos-containing materials identified. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.	
M		Dining Room	Sample	B51-ASB.16	07-Aug-12		None	Vinyl Sheet Flooring			Dining Room- Sheet flooring, small irregular stone pattern with brown background	No Accessible ACM			No asbestos detected. No action required. No accessible asbestos-containing materials identified. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.	
M		Public Washroom	Sample	B51-ASB.17	07-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Washroom- Sheet flooring, small irregular square pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl asbestos sheet flooring located within the public washroom. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Dining Room	Sample	B51-ASB.18	07-Aug-12		None	Stipple Ceiling Texture			Dining Room- Stipple ceiling texture	No Accessible ACM			No asbestos detected. No action required. No accessible asbestos-containing materials identified. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.	
M	101	Res Room	Sample	B51-ASB.19	07-Aug-12		None	Stipple Ceiling Texture			101 Room- Stipple ceiling texture	No Accessible ACM			No asbestos detected. No action required. No accessible asbestos-containing materials identified. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.	

Invermay Health Centre			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
M	101	Res Room	Sample	B51-ASB.20	07-Aug-12		None	Vinyl Sheet Flooring			101 Room- Sheet flooring, white and yellow tiny square pattern	No Accessible ACM			No asbestos detected. No action required. No accessible asbestos-containing materials identified. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.	
M		West Wing	Sample	B51-ASB.21	07-Aug-12	Chrysotile	30%	Transite Pipe	Good	3	Corridor adjacent 113- Transite pipe	Transite Pipe	Low	Manage	Asbestos-containing transite pipe was identified in the west wing. In general, the transite pipe was observed in good condition. It is our recommendation that the transite pipe be managed in place.	
M		Central Corridor adj. Dinning	Sample Rep	B51-ASB.21	07-Aug-12	Chrysotile	30%	Transite Pipe	Good	3	Corridor adjacent 113- Transite pipe	Transite Pipe	Low	Manage	Asbestos-containing transite pipe was identified in central corridor adj. dinning. In general, the transite pipe was observed in good condition. It is our recommendation that the transite pipe be managed in place.	
M		Storage Room adj. Entrance	Sample Rep	B51-ASB.17	07-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Washroom- Sheet flooring, small irregular square pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl asbestos sheet flooring located within the Storage Room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Main Entrance	Sample Rep	B51-ASB.17	07-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Washroom- Sheet flooring, small irregular square pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl asbestos sheet flooring located within the Main Entrance. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Dirty Linen	Sample Rep	B51-ASB.17	07-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Washroom- Sheet flooring, small irregular square pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl asbestos sheet flooring located within the Dirty Linen. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Mailbox/ Dog Canal Room	Sample Rep	B51-ASB.17	07-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Washroom- Sheet flooring, small irregular square pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl asbestos sheet flooring located within the Mailbox/ Dog Canal Room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Back Entrance	Sample Rep	B51-ASB.17	07-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Washroom- Sheet flooring, small irregular square pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl asbestos sheet flooring located within the Back Entrance. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Utility/ Laundry Room	Sample Rep	B51-ASB.17	07-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Washroom- Sheet flooring, small irregular square pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl asbestos sheet flooring located within the Utility/ Laundry Room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Pop Storage Room	Sample Rep	B51-ASB.17	07-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Washroom- Sheet flooring, small irregular square pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl asbestos sheet flooring located within the Pop Storage Room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Laundry Room	Sample Rep	B51-ASB.17	07-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Washroom- Sheet flooring, small irregular square pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl asbestos sheet flooring located within the laundry Room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	

Invermay Health Centre			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
M		Linen	Sample Rep	B51-ASB.17	07-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Washroom- Sheet flooring, small irregular square pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl asbestos sheet flooring located within the linen Room Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Storage Room	Sample Rep	B51-ASB.17	07-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Washroom- Sheet flooring, small irregular square pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl asbestos sheet flooring located within the Storage Room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	107	Res Room	Sample Rep	B51-ASB.17	07-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Washroom- Sheet flooring, small irregular square pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl asbestos sheet flooring located within the resident room Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	108	Res Room	Sample Rep	B51-ASB.17	07-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Washroom- Sheet flooring, small irregular square pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl asbestos sheet flooring located within the resident room Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	109	Res Room	Sample Rep	B51-ASB.17	07-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Washroom- Sheet flooring, small irregular square pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl asbestos sheet flooring located within the resident room Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	110	Res Room	Sample Rep	B51-ASB.17	07-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Washroom- Sheet flooring, small irregular square pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl asbestos sheet flooring located within the resident room Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	111	Res Room	Sample Rep	B51-ASB.17	07-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Washroom- Sheet flooring, small irregular square pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl asbestos sheet flooring located within the resident room Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	112	Res Room	Sample Rep	B51-ASB.17	07-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Washroom- Sheet flooring, small irregular square pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl asbestos sheet flooring located within the resident room Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	113	Res Room	Sample Rep	B51-ASB.17	07-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Washroom- Sheet flooring, small irregular square pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl asbestos sheet flooring located within the resident room Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	114	Res Room	Sample Rep	B51-ASB.17	07-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Washroom- Sheet flooring, small irregular square pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl asbestos sheet flooring located within the resident room Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	115	Res Room	Sample Rep	B51-ASB.17	07-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Washroom- Sheet flooring, small irregular square pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl asbestos sheet flooring located within the resident room Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	117	Res Room	Sample Rep	B51-ASB.17	07-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Washroom- Sheet flooring, small irregular square pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl asbestos sheet flooring located within the resident room Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	

Invermay Health Centre			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
M		Hair Dressing	Sample Rep	B51-ASB.17	07-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Washroom- Sheet flooring, small irregular square pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl asbestos sheet flooring located within the hair dressing room Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Storage	Sample Rep	B51-ASB.17	07-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Washroom- Sheet flooring, small irregular square pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl asbestos sheet flooring located within the Storage Room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Clean Utility	Sample Rep	B51-ASB.17	07-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Washroom- Sheet flooring, small irregular square pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl asbestos sheet flooring located within the clean utility room Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		House Keeping Office	Sample Rep	B51-ASB.17	07-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Washroom- Sheet flooring, small irregular square pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl asbestos sheet flooring located within the house keeping room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Clean Linen	Sample Rep	B51-ASB.17	07-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Washroom- Sheet flooring, small irregular square pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl asbestos sheet flooring located within the Clean Linen. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	