

Ituna Pioneer Health Care Center			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
C		Crawlspace	Sample	B51-ASB.8	09-Aug-12	Chrysotile	80%	Mud compound	Poor	1	Crawlspace- Mud compound on cement beam adjacent crawlspace entry	Mud Compound, Fire-Stop Material	Moderate	Remove	Remove mud compound from cement beam adjacent basement crawlspace entry door.	
C		Crawlspace	Sample	B51-ASB.9	09-Aug-12		None	Pipeline Fitting Compound			Crawlspace- Pipe fitting on small line, 20' from entry door	Mud Compound, Fire-Stop Material			No asbestos detected. No action required.	
C		Crawlspace	Sample	B51-ASB.10	09-Aug-12		None	Pipeline Fitting Compound			Crawlspace- Pipe fitting on small line adjacent sample #9, adjacent cement pillar	Mud Compound, Fire-Stop Material			No asbestos detected. No action required.	
C		Crawlspace	Sample	B51-ASB.18	09-Aug-12	Chrysotile	70%	Fire-Stop Material	Good	3	Crawlspace- Fire-stop material at pipe penetration, adjacent crawlspace entry door	Mud Compound, Fire-Stop Material	Low	Manage	Some fire stop was inaccessible to label by the basement crawlspace entry door. Due to the amount of piping and ducting, consider all fire-stop material to be ACM.	
C		Crawlspace	Sample	B51-ASB.19	09-Aug-12		None	Pipeline Fitting Compound			Crawlspace- Pipe fitting on small line adjacent to west dividing crawlspace wall, adjacent air vent	Mud Compound, Fire-Stop Material			No asbestos detected. No action required.	
C		Crawlspace	Sample	B51-ASB.20	09-Aug-12	Chrysotile	60%	Fire-Stop Material	Poor	1	Crawlspace- Fire-stop material at pipe penetration, adjacent west crawlspace entry door	Mud Compound, Fire-Stop Material	Mod/High	Repair/Remove	Remove fire stop material debris laying on ground and repair damaged fire stop at pipe penetrations along the dividing wall into the north crawl space, adjacent crawl space door.	
C		Crawlspace	Sample	B51-ASB.21	09-Aug-12		None	Pipeline Fitting Compound			West Crawlspace- Pipe fitting on small line at the west end of crawlspace, along south wall, adjacent ladder to access	Mud Compound, Fire-Stop Material			No asbestos detected. No action required.	
C		Crawlspace	Sample	B51-ASB.8	09-Aug-12	Chrysotile	80%	Mud compound	Poor	1	Crawlspace- Mud compound on cement beam adjacent crawlspace entry	Mud Compound, Fire-Stop Material	Moderate	Remove	Remove mud compound from cement beam adjacent basement crawlspace entry door.	
C		Crawlspace	Sample	B51-ASB.9	09-Aug-12		None	Pipeline Fitting Compound			Crawlspace- Pipe fitting on small line, 20' from entry door	Mud Compound, Fire-Stop Material			No asbestos detected. No action required.	
C		Crawlspace	Sample	B51-ASB.10	09-Aug-12		None	Pipeline Fitting Compound			Crawlspace- Pipe fitting on small line adjacent sample #9, adjacent cement pillar	Mud Compound, Fire-Stop Material			No asbestos detected. No action required.	
C		Crawlspace	Sample	B51-ASB.18	09-Aug-12	Chrysotile	70%	Fire-Stop Material	Good	3	Crawlspace- Fire-stop material at pipe penetration, adjacent crawlspace entry door	Mud Compound, Fire-Stop Material	Low	Manage	Some fire stop was inaccessible to label by the basement crawlspace entry door. Due to the amount of piping and ducting, consider all fire-stop material to be ACM.	

Ituna Pioneer Health Care Center			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
B		Boiler Room	Sample	B51-ASB.1	09-Aug-12		None	Duct Gasket			Boiler Room- Duct gasket material	Mud Compound, Fire Stop Material, Pipeline Fitting Compound,			No asbestos detected. No action required.	
B		Boiler Room	Sample	B51-ASB.2	09-Aug-12		None	Mud compound			Boiler Room- Mud compound from "T" joint, from pump #2	Mud Compound, Fire Stop Material, Pipeline Fitting Compound,			No asbestos detected. No action required.	
B		Boiler Room	Sample	B51-ASB.3	09-Aug-12	Chrysotile	70%	Mud compound	Good	3	Boiler Room- Mud compound from boiler exhaust	Mud Compound, Fire Stop Material, Pipeline Fitting Compound,	Low	Manage	Asbestos was identified within the boiler breaching within the boiler room. The mud compound was observed in good condition, and well encapsulated. It is our recommendation that the breaching be managed in place.	
B		Boiler Room	Sample	B51-ASB.4	09-Aug-12		None	Pipeline Fitting Compound			Boiler Room- Pipe fitting on medium line in the northeast corner of room, adjacent boiler	Mud Compound, Fire Stop Material, Pipeline Fitting Compound,			No asbestos detected. No action required.	
B		Boiler Room	Sample	B51-ASB.5	09-Aug-12	Chrysotile	70%	Mud compound	Moderate	1	Boiler Room- Mud compound off of large white tank	Mud Compound, Fire Stop Material, Pipeline Fitting Compound,	Moderate	Repair/Remove	Repair damages in insulation on tank and clean up debris on tank and adjacent area	
B		Boiler Room	Sample	B51-ASB.6	09-Aug-12		None	Duct Expansion Tape			Boiler Room- Duct expansion tape off of ducting	Mud Compound, Fire Stop Material, Pipeline Fitting Compound,			No asbestos detected. No action required.	
B		Boiler Room	Sample	B51-ASB.16	09-Aug-12	Chrysotile	20%	Pipeline Fitting Compound	Good	3	Boiler Room- Pipe fitting on small line, above boiler room entry door	Mud Compound, Fire Stop Material, Pipeline Fitting Compound,	Low	Manage	Asbestos-containing fittings were identified in the boiler room. In general, these fittings were observed in moderate condition. It is our recommendation that these fittings be managed in place.	
B		Boiler Room	Sample	B51-ASB.17	09-Aug-12	Chrysotile	70%	Fire-Stop Material	Good	3	Boiler Room- Fire stop material at pipe penetrations, above boiler room entry door	Mud Compound, Fire-Stop Material, Pipeline Fitting Compound,	Low	Manage	No asbestos detected. No action required.	
B		Boiler Room	Sample Rep.	B51-ASB.8	09-Aug-12	Chrysotile	80%	Mud compound	Poor	1	Crawlspace- Mud compound on cement beam adjacent crawlspace entry	Mud Compound, Fire-Stop Material, Pipeline Fitting Compound,	Moderate	Remove	Remove mud compound from wall in the northeast corner of room above the cut out in the cinder block wall.	
B		Basement	Sample	B51-ASB.7	09-Aug-12		None	Pipeline Fitting Compound			Basement- Pipe fitting on small line adjacent freezers	No accessible ACM			No action required. No accessible asbestos-containing materials identified. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.	
1		Main Corridor	Sample	B51-ASB.11	09-Aug-12		None	Vinyl Sheet Flooring			Main Corridor- Sheet flooring, pink stone pattern	No accessible ACM			No action required. No accessible asbestos-containing materials identified. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.	

Ituna Pioneer Health Care Center			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
1		Main Corridor	Sample	B51-ASB.12	09-Aug-12		None	Stipple Ceiling Texture			Main Corridor- Stipple ceiling texture	No accessible ACM			No action required. No accessible asbestos-containing materials identified. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.	
1		Tub Room	Sample	B51-ASB.14	09-Aug-12		none	Ceiling Tiles			Tub Room- 2' by 2' ceiling tile with pin holes	No accessible ACM			No action required. No accessible asbestos-containing materials identified. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.	
1		Resident Washroom across from Nurse Station	Sample Rep	B51-ASB.13	09-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	Room 112- Sheet flooring, stone pattern	Asbestos Sheet Floor Covering	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the resident washroom. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1		Public Washroom across from Nurse Station	Sample Rep	B51-ASB.13	09-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	Room 112- Sheet flooring, stone pattern	Asbestos Sheet Floor Covering	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the resident washroom. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1	101	Resident Room	Sample Rep	B51-ASB.13	09-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	Room 112- Sheet flooring, stone pattern	Asbestos Sheet Floor Covering	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the resident room and washroom, although only the main entry has a door jamb. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1	102	Resident Room	Sample Rep	B51-ASB.13	09-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	Room 112- Sheet flooring, stone pattern	Asbestos Sheet Floor Covering	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the resident room and washroom, although only the main entry has a door jamb. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1	103	Resident Room	Sample Rep	B51-ASB.13	09-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	Room 112- Sheet flooring, stone pattern	Asbestos Sheet Floor Covering	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the resident room and washroom, although only the main entry has a door jamb. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1	104	Resident Room	Sample Rep	B51-ASB.13	09-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	Room 112- Sheet flooring, stone pattern	Asbestos Sheet Floor Covering	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the resident room and washroom, although only the main entry has a door jamb. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1	105	Resident Room	Sample Rep	B51-ASB.13	09-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	Room 112- Sheet flooring, stone pattern	Asbestos Sheet Floor Covering	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the resident room and washroom, although only the main entry has a door jamb. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1	106	Resident Room	Sample Rep	B51-ASB.13	09-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	Room 112- Sheet flooring, stone pattern	Asbestos Sheet Floor Covering	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the resident room and washroom, although only the main entry has a door jamb. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	

Ituna Pioneer Health Care Center			BERSCH & ASSOCIATES LTD.												
			SAMPLE DATA												
Floor	Room Number	Use	SAMPLE SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments
1	107	Resident Room	Sample Rep	B51-ASB.13	09-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	Room 112- Sheet flooring, stone pattern	Asbestos Sheet Floor Covering	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the resident room and washroom, although only the main entry has a door jamb. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
1	108	Resident Room	Sample Rep	B51-ASB.13	09-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	Room 112- Sheet flooring, stone pattern	Asbestos Sheet Floor Covering	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the resident room and washroom, although only the main entry has a door jamb. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
1	109	Resident Room	Sample Rep	B51-ASB.13	09-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	Room 112- Sheet flooring, stone pattern	Asbestos Sheet Floor Covering	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the resident room and washroom, although only the main entry has a door jamb. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
1	110	Resident Room	Sample Rep	B51-ASB.13	09-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	Room 112- Sheet flooring, stone pattern	Asbestos Sheet Floor Covering	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the resident room and washroom, although only the main entry has a door jamb. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
1	111	Resident Room	Sample Rep	B51-ASB.13	09-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	Room 112- Sheet flooring, stone pattern	Asbestos Sheet Floor Covering	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the resident room and washroom, although only the main entry has a door jamb. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
1	112	Resident Room	Sample	B51-ASB.13	09-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	Room 112- Sheet flooring, stone pattern	Asbestos Sheet Floor Covering	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the resident room and washroom, although only the main entry has a door jamb. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
1	201	Resident Room	Sample Rep	B51-ASB.15	09-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Room 215- Sheet flooring, orange and white stone pattern	Asbestos Sheet Floor Covering	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the resident room and washroom, although only the main entry has a door jamb. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
1	202	Resident Room	Sample Rep	B51-ASB.15	09-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Room 215- Sheet flooring, orange and white stone pattern	Asbestos Sheet Floor Covering	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the resident room and washroom, although only the main entry has a door jamb. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
1	203	Resident Room	Sample Rep	B51-ASB.15	09-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Room 215- Sheet flooring, orange and white stone pattern	Asbestos Sheet Floor Covering	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the resident room and washroom, although only the main entry has a door jamb. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.

Ituna Pioneer Health Care Center			BERSCH & ASSOCIATES LTD.												
			SAMPLE DATA												
Floor	Room Number	Use	SAMPLE SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments
1	204	Resident Room	Sample Rep	B51-ASB.15	09-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Room 215- Sheet flooring, orange and white stone pattern	Asbestos Sheet Floor Covering	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the resident room and washroom, although only the main entry has a door jamb. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
1	205	Resident Room	Sample Rep	B51-ASB.15	09-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Room 215- Sheet flooring, orange and white stone pattern	Asbestos Sheet Floor Covering	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the resident room and washroom, although only the main entry has a door jamb. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
1	206	Resident Room	Sample Rep	B51-ASB.15	09-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Room 215- Sheet flooring, orange and white stone pattern	Asbestos Sheet Floor Covering	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the resident room and washroom, although only the main entry has a door jamb. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
1	207	Resident Room	Sample Rep	B51-ASB.15	09-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Room 215- Sheet flooring, orange and white stone pattern	Asbestos Sheet Floor Covering	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the resident room and washroom, although only the main entry has a door jamb. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
1	208	Resident Room	Sample Rep	B51-ASB.15	09-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Room 215- Sheet flooring, orange and white stone pattern	Asbestos Sheet Floor Covering	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the resident room and washroom, although only the main entry has a door jamb. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
1	209	Resident Room	Sample Rep	B51-ASB.15	09-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Room 215- Sheet flooring, orange and white stone pattern	Asbestos Sheet Floor Covering	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the resident room and washroom, although only the main entry has a door jamb. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
1	210	Resident Room	Sample Rep	B51-ASB.15	09-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Room 215- Sheet flooring, orange and white stone pattern	Asbestos Sheet Floor Covering	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the resident room and washroom, although only the main entry has a door jamb. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
1	211	Resident Room	Sample Rep	B51-ASB.15	09-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Room 215- Sheet flooring, orange and white stone pattern	Asbestos Sheet Floor Covering	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the resident room and washroom, although only the main entry has a door jamb. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
1	212	Resident Room	Sample Rep	B51-ASB.15	09-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Room 215- Sheet flooring, orange and white stone pattern	Asbestos Sheet Floor Covering	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the resident room and washroom, although only the main entry has a door jamb. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.

Ituna Pioneer Health Care Center			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
1	213	Resident Room	Sample Rep	B51-ASB.15	09-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Room 215- Sheet flooring, orange and white stone pattern	Asbestos Sheet Floor Covering	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the resident room and washroom, although only the main entry has a door jamb. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1	214	Resident Room	Sample Rep	B51-ASB.15	09-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Room 215- Sheet flooring, orange and white stone pattern	Asbestos Sheet Floor Covering	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the resident room and washroom, although only the main entry has a door jamb. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1	215	Resident Room	Sample	B51-ASB.15	09-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Room 215- Sheet flooring, orange and white stone pattern	Asbestos Sheet Floor Covering	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the resident room and washroom, although only the main entry has a door jamb. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1	216	Resident Room	Sample Rep	B51-ASB.15	09-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Room 215- Sheet flooring, orange and white stone pattern	Asbestos Sheet Floor Covering	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the resident room and washroom, although only the main entry has a door jamb. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1	218	Resident Room	Sample Rep	B51-ASB.15	09-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Room 215- Sheet flooring, orange and white stone pattern	Asbestos Sheet Floor Covering	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the resident room and washroom, although only the main entry has a door jamb. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
1		Generator Room	Sample	B51-ASB.22	09-Aug-12	Chrysotile	80%	Duct Expansion Gasket	Good	3	Generator Room- Duct expansion gasket	Duct Expansion Gasket	Low	Manage	Asbestos-containing duct gasket was identified in the generator room. In general, the duct gasket was observed in good condition. It is our recommendation that the gasket be managed in place.	