

Kamsack Hospital			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
C		Crawl Space	Sample	B51-ASB.7	08-Aug-12	None	None	Pipeline Fitting Compound			Crawl Space- Pipe fitting on large line adjacent to crawl space entry door	Transite Pipe			No asbestos detected. No action required. No accessible asbestos-containing materials identified. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.	
C		Crawl Space	Sample	B51-ASB.8	08-Aug-12	None	None	Pipeline Fitting Compound			Crawl Space- Pipe fitting on medium "5" line, adjacent to crawl space entry door	Transite Pipe			No asbestos detected. No action required. No accessible asbestos-containing materials identified. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.	
C		Crawl Space	Sample Rep	B51-ASB.2	08-Aug-12	Chrysotile	30%	Transite Pipe	Good	3	Boiler Room- Transite pipe adjacent ladder	Transite Pipe	Low	Manage	Asbestos-containing transite pipe was identified in the crawlspace. In general, the transite pipe was observed in good condition. It is our recommendation that the transite pipe be managed in place.	
M		Boiler Room	Sample	B51-ASB.1	08-Aug-12	None	None	Pipeline Fitting Compound			Boiler Room- Pipe fitting on medium blue line adjacent ladder	Transite Pipe, Pipeline Fitting Compound				
M		Boiler Room	Sample	B51-ASB.2	08-Aug-12	Chrysotile	30%	Transite Pipe	Good	3	Boiler Room- Transite pipe adjacent ladder	Transite Pipe, Pipeline Fitting Compound	Low	Manage	Asbestos-containing transite pipe was identified in the boiler room. In general, the transite pipe was observed in good condition. It is our recommendation that the transite pipe be managed in place.	
M		Boiler Room	Sample	B51-ASB.3	08-Aug-12	None	None	Pipeline Fitting Compound			Boiler Room- Pipe fitting on medium blue line adjacent fan unit, above mezzanine	Transite Pipe, Pipeline Fitting Compound				
M		Boiler Room	Sample	B51-ASB.4	08-Aug-12	None	None	Pipeline Fitting Compound			Boiler Room- Pipe fitting on small green "cold water" line adjacent water conditioning tanks	Transite Pipe, Pipeline Fitting Compound				
M		Boiler Room	Sample	B51-ASB.5	08-Aug-12	None	None	Mud compound			Boiler Room- Mud compound on large blue exhaust pipe leading off of orange water heaters	Transite Pipe, Pipeline Fitting Compound				
M		Boiler Room	Sample	B51-ASB.6	08-Aug-12	Chrysotile	70%	Pipeline Fitting Compound	Poor	2	Boiler Room- Pipe fitting on large blue line adjacent fan units above mezzanine	Transite Pipe, Pipeline Fitting Compound	Low/Mod	Cleanup/Manage	Clean up debris on second level fan unit and repair pipeline fitting on large blue line on second level adjacent the valve close to the floor.	
M		Corridor	Sample	B51-ASB.9	08-Aug-12	None	None	Ceiling Tiles			Corridor Adjacent Home Care- 2' by 4' ceiling tile with pin holes	No Asbestos Detected			No asbestos detected. No action required. No accessible asbestos-containing materials identified. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.	
M		Kitchen	Sample	B51-ASB.10	08-Aug-12	None	None	Fireproofing			Kitchen- Spray applied fire proofing material, along exterior wall	No Asbestos Detected			No asbestos detected. No action required. No accessible asbestos-containing materials identified. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.	

Kamsack Hospital			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
M		Staff Cafeteria	Sample	B51-ASB.11	08-Aug-12	None	None	Ceiling Tiles			Staff Cafeteria- 2' by 2' ceiling tile, wavy and ridged surface pattern	No Asbestos Detected			No asbestos detected. No action required. No accessible asbestos-containing materials identified. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.	
M		House Keeping	Sample	B51-ASB.12	08-Aug-12	None	None	Vinyl Floor Tile			House Keeping- 12" by 12" floor tile, off white with black spec	No Asbestos Detected			No asbestos detected. No action required. No accessible asbestos-containing materials identified. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.	
M		Corridor	Sample	B51-ASB.13	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	Corridor- Sheet flooring, irregular square pattern with brown background	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the corridor. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Ward Clerk	Sample	B51-ASB.14	08-Aug-12	None	None	Vinyl Floor Tile			Ward Clerk- 12" by 12" floor tile, white with greenish streak	No Asbestos Detected			No asbestos detected. No action required. No accessible asbestos-containing materials identified. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.	
M		Corridor	Sample	B51-ASB.15	08-Aug-12	None	None	Ceiling Tiles			Corridor- 2' by 4' ceiling tile, small gashes and pin holes	No Asbestos Detected			No asbestos detected. No action required. No accessible asbestos-containing materials identified. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.	
M		X-Ray Change Room	Sample	B51-ASB.16	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	X-Ray Change Room- Sheet flooring, off white and brown stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the X-ray change room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		X-Ray Change Room	Sample	B51-ASB.17	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	X-Ray Change Room- Sheet flooring, dark brown stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the X-ray change room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		X-Ray	Sample	B51-ASB.18	08-Aug-12	None	None	Fireproofing			X-Ray- Fireproofing above the ceiling tile	No Asbestos Detected			No asbestos detected. No action required. No accessible asbestos-containing materials identified. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.	
M		Acute Wing	Sample	B51-ASB.19	08-Aug-12	None	None	Pipeline Fitting Compound			Acute Wing- Pipeline fitting on small line above the ceiling tile, at exit sign at the far end	No Asbestos Detected			No asbestos detected. No action required. No accessible asbestos-containing materials identified. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.	
M		Laundry	Sample	B51-ASB.20	08-Aug-12	None	None	Pipeline Fitting Compound			Laundry- Pipeline fitting on small white line along south wall	No Asbestos Detected			No asbestos detected. No action required. No accessible asbestos-containing materials identified. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.	

Kamsack Hospital			BERSCH & ASSOCIATES LTD.												
			SAMPLE DATA												
Floor	Room Number	Use	SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments
M		X-Ray Preparation Room	Sample Rep	B51-ASB.16	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	X-Ray Change Room- Sheet flooring, off white and brown stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the X-ray preparation room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
M		X-Ray Washroom	Sample Rep	B51-ASB.16	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	X-Ray Change Room- Sheet flooring, off white and brown stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the X-ray washroom. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
M		X-Ray Closet	Sample Rep	B51-ASB.16	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	X-Ray Change Room- Sheet flooring, off white and brown stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the X-ray closet. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
M		Cast Room	Sample Rep	B51-ASB.16	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	X-Ray Change Room- Sheet flooring, off white and brown stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the cast room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
M		Emergency Treatment	Sample Rep	B51-ASB.16	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	X-Ray Change Room- Sheet flooring, off white and brown stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the emergency treatment. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
M		Corridor adj. X-Ray Services and Laboratory Services	Sample Rep	B51-ASB.16	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	X-Ray Change Room- Sheet flooring, off white and brown stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the corridor. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
M		Washroom	Sample Rep	B51-ASB.16	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	X-Ray Change Room- Sheet flooring, off white and brown stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the washroom. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
M		Ladies Staff Change Room	Sample Rep	B51-ASB.16	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	X-Ray Change Room- Sheet flooring, off white and brown stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the ladies staff change room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
M		Out-Patient Services	Sample Rep	B51-ASB.16	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	X-Ray Change Room- Sheet flooring, off white and brown stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the out-patient services room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
M		Out-Patient Services Washroom	Sample Rep	B51-ASB.16	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	X-Ray Change Room- Sheet flooring, off white and brown stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the out-patient services washroom. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
M		Laboratory Services	Sample Rep	B51-ASB.13	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	Corridor- Sheet flooring, irregular square pattern with brown background	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the laboratory services room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
M		Microbiology	Sample Rep	B51-ASB.13	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	Corridor- Sheet flooring, irregular square pattern with brown background	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the microbiology room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.

Kamsack Hospital			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
M		Health Records Services	Sample Rep	B51-ASB.13	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	Corridor- Sheet flooring, irregular square pattern with brown background	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the health records services room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Men's Washroom	Sample Rep	B51-ASB.13	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	Corridor- Sheet flooring, irregular square pattern with brown background	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the men's washroom. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Women's Washroom	Sample Rep	B51-ASB.13	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	Corridor- Sheet flooring, irregular square pattern with brown background	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the women's washroom. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Physiotherapy Services	Sample Rep	B51-ASB.2	08-Aug-12	Chrysotile	30%	Transite Pipe	Good	3	Boiler Room- Transite pipe adjacent ladder	Transite Pipe	Low	Manage	Asbestos-containing transite pipe was identified in the physiotherapy services. In general, the transite pipe was observed in good condition. It is our recommendation that the transite pipe be managed in place.	
M		Administration Offices	Sample Rep	B51-ASB.2	08-Aug-12	Chrysotile	30%	Transite Pipe	Good	3	Boiler Room- Transite pipe adjacent ladder	Transite Pipe	Low	Manage	Asbestos-containing transite pipe was identified in the administration offices. In general, the transite pipe was observed in good condition. It is our recommendation that the transite pipe be managed in place.	
M		Business Office	Sample Rep	B51-ASB.2	08-Aug-12	Chrysotile	30%	Transite Pipe	Good	3	Boiler Room- Transite pipe adjacent ladder	Transite Pipe	Low	Manage	Asbestos-containing transite pipe was identified in the business office. In general, the transite pipe was observed in good condition. It is our recommendation that the transite pipe be managed in place.	
M		Main Foyer	Sample Rep	B51-ASB.13	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	Corridor- Sheet flooring, irregular square pattern with brown background	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl asbestos sheet flooring located within the main foyer. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Clean Utility D	Sample Rep	B51-ASB.13	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	Corridor- Sheet flooring, irregular square pattern with brown background	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl asbestos sheet flooring located within the clean utility D. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Men's Staff Washroom	Sample Rep	B51-ASB.13	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	Corridor- Sheet flooring, irregular square pattern with brown background	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the men's staff washroom. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Women's Staff Washroom	Sample Rep	B51-ASB.13	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	Corridor- Sheet flooring, irregular square pattern with brown background	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the women's staff washroom. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Clean Utility B	Sample Rep	B51-ASB.13	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	Corridor- Sheet flooring, irregular square pattern with brown background	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the clean utility B. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		O.R. Locker Room	Sample Rep	B51-ASB.13	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	Corridor- Sheet flooring, irregular square pattern with brown background	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the O.R. Locker room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	

Kamsack Hospital			BERSCH & ASSOCIATES LTD.												
			SAMPLE DATA												
Floor	Room Number	Use	SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments
M		Men's Washroom	Sample Rep	B51-ASB.13	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	Corridor- Sheet flooring, irregular square pattern with brown background	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the men's washroom. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
M		Women's Washroom	Sample Rep	B51-ASB.13	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	Corridor- Sheet flooring, irregular square pattern with brown background	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the women's washroom. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
M		Pharmacy	Sample Rep	B51-ASB.16	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	X-Ray Change Room- Sheet flooring, off white and brown stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl asbestos sheet flooring located within the pharmacy. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
M	2	Patient Room	Sample Rep	B51-ASB.16	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	X-Ray Change Room- Sheet flooring, off white and brown stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the patient room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
M	3	Patient Room	Sample Rep	B51-ASB.16	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	X-Ray Change Room- Sheet flooring, off white and brown stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the patient room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
M		Intensive Care Unit	Sample Rep	B51-ASB.16	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	X-Ray Change Room- Sheet flooring, off white and brown stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the intensive care unit. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
M		Lounge adj. Room 5	Sample Rep	B51-ASB.16	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	X-Ray Change Room- Sheet flooring, off white and brown stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the lounge. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
M	5	Patient Room	Sample Rep	B51-ASB.16	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	X-Ray Change Room- Sheet flooring, off white and brown stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the patient room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
M	6	Patient Room	Sample Rep	B51-ASB.16	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	X-Ray Change Room- Sheet flooring, off white and brown stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the patient room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
M	7	Patient Room	Sample Rep	B51-ASB.16	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	X-Ray Change Room- Sheet flooring, off white and brown stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the patient room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
M	8	Patient Room	Sample Rep	B51-ASB.16	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	X-Ray Change Room- Sheet flooring, off white and brown stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the patient room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.
M	9	Patient Room	Sample Rep	B51-ASB.16	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	X-Ray Change Room- Sheet flooring, off white and brown stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the patient room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.

Kamsack Hospital			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
M	11	Patient Room	Sample Rep	B51-ASB.16	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	X-Ray Change Room- Sheet flooring, off white and brown stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the patient room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	12	Patient Room	Sample Rep	B51-ASB.16	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	X-Ray Change Room- Sheet flooring, off white and brown stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the patient room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	14	Patient Room	Sample Rep	B51-ASB.16	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	X-Ray Change Room- Sheet flooring, off white and brown stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the patient room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	15	Patient Room	Sample Rep	B51-ASB.16	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	X-Ray Change Room- Sheet flooring, off white and brown stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the patient room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	16	Patient Room	Sample Rep	B51-ASB.16	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	X-Ray Change Room- Sheet flooring, off white and brown stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the patient room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Pharmacy Office	Sample Rep	B51-ASB.16	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	X-Ray Change Room- Sheet flooring, off white and brown stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the pharmacy office. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	20	Patient Room	Sample Rep	B51-ASB.16	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	X-Ray Change Room- Sheet flooring, off white and brown stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the patient room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	21	Patient Room	Sample Rep	B51-ASB.16	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	X-Ray Change Room- Sheet flooring, off white and brown stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the patient room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	22	Patient Room	Sample Rep	B51-ASB.16	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	X-Ray Change Room- Sheet flooring, off white and brown stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the patient room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	23	Patient Room	Sample Rep	B51-ASB.16	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	X-Ray Change Room- Sheet flooring, off white and brown stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the patient room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	24	Patient Room	Sample Rep	B51-ASB.16	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	X-Ray Change Room- Sheet flooring, off white and brown stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the patient room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	25	Patient Room	Sample Rep	B51-ASB.16	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	X-Ray Change Room- Sheet flooring, off white and brown stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the patient room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	

Kamsack Hospital			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
M	26	Patient Room	Sample Rep	B51-ASB.16	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	X-Ray Change Room- Sheet flooring, off white and brown stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the patient room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	27	Patient Room	Sample Rep	B51-ASB.16	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	X-Ray Change Room- Sheet flooring, off white and brown stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the patient room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	28	Patient Room	Sample Rep	B51-ASB.16	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	X-Ray Change Room- Sheet flooring, off white and brown stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the patient room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	29	Patient Room	Sample Rep	B51-ASB.16	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	X-Ray Change Room- Sheet flooring, off white and brown stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the patient room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	30	Patient Room	Sample Rep	B51-ASB.16	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	X-Ray Change Room- Sheet flooring, off white and brown stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the patient room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Nurse Station	Sample Rep	B51-ASB.2	08-Aug-12	Chrysotile	30%	Transite Pipe	Good	3	Boiler Room- Transite pipe adjacent ladder	Transite Pipe, Asbestos Sheet Flooring	Low	Manage	Asbestos-containing transite pipe was identified in the nurse station. In general, the transite pipe was observed in good condition. It is our recommendation that the transite pipe be managed in place.	
M		Nurse Station	Sample Rep	B51-ASB.13	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	Corridor- Sheet flooring, irregular square pattern with brown background	Transite Pipe, Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the nurse station. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Acute Wing	Sample Rep	B51-ASB.2	08-Aug-12	Chrysotile	30%	Transite Pipe	Good	3	Boiler Room- Transite pipe adjacent ladder	Transite Pipe, Asbestos Sheet Flooring	Low	Manage	Asbestos-containing transite pipe was identified in the acute wing. In general, the transite pipe was observed in good condition. It is our recommendation that the transite pipe be managed in place.	
M		Acute Wing	Sample Rep	B51-ASB.13	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	Corridor- Sheet flooring, irregular square pattern with brown background	Transite Pipe, Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the acute wing. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Gift Shop	Sample Rep	B51-ASB.13	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	Corridor- Sheet flooring, irregular square pattern with brown background	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the gift shop. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		L.T. Wing	Sample Rep	B51-ASB.13	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	Corridor- Sheet flooring, irregular square pattern with brown background	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the L.T. wing. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Med Room	Sample Rep	B51-ASB.13	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	Corridor- Sheet flooring, irregular square pattern with brown background	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the med room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Nursery	Sample Rep	B51-ASB.13	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	Corridor- Sheet flooring, irregular square pattern with brown background	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the nursery. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	

Kamsack Hospital			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
M		Kitchenette	Sample Rep	B51-ASB.13	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	Corridor- Sheet flooring, irregular square pattern with brown background	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the kitchenette. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Patient's Lounge D	Sample Rep	B51-ASB.17	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	X-Ray Change Room- Sheet flooring, dark brown stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the patient's lounge D. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Patient's Lounge A	Sample Rep	B51-ASB.17	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	X-Ray Change Room- Sheet flooring, dark brown stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the patient's lounge A. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Labour Room	Sample Rep	B51-ASB.16	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	X-Ray Change Room- Sheet flooring, off white and brown stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the labour room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		O.R. House Keeping Room	Sample Rep	B51-ASB.16	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	X-Ray Change Room- Sheet flooring, off white and brown stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the O.R. House keeping room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Recovery Room	Sample Rep	B51-ASB.16	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	X-Ray Change Room- Sheet flooring, off white and brown stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the recovery room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Delivery Room	Sample Rep	B51-ASB.16	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	X-Ray Change Room- Sheet flooring, off white and brown stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the delivery room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Operating Room	Sample Rep	B51-ASB.16	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	X-Ray Change Room- Sheet flooring, off white and brown stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the operating room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Central Corridor	Sample Rep	B51-ASB.13	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	Corridor- Sheet flooring, irregular square pattern with brown background	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the corridor. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		North Corridor	Sample Rep	B51-ASB.13	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	Corridor- Sheet flooring, irregular square pattern with brown background	Transite Pipe, Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the corridor. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		North Corridor	Sample Rep	B51-ASB.2	08-Aug-12	Chrysotile	30%	Transite Pipe	Good	3	Boiler Room- Transite pipe adjacent ladder	Transite Pipe, Asbestos Sheet Flooring	Low	Manage	The Transite pipe near the kitchen was marked with a red dot.	
M		Staff Washroom	Sample Rep	B51-ASB.13	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	Corridor- Sheet flooring, irregular square pattern with brown background	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the staff washroom. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Homecare Direction	Sample Rep	B51-ASB.13	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	Corridor- Sheet flooring, irregular square pattern with brown background	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the homecare direction. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	

Kamsack Hospital			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
M		Engineer Office	Sample Rep	B51-ASB.13	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	Corridor- Sheet flooring, irregular square pattern with brown background	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the engineer office. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Dryer Exhaust Room	Sample Rep	B51-ASB.17	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	X-Ray Change Room- Sheet flooring, dark brown stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the dryer exhaust room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Laundry Corridor	Sample Rep	B51-ASB.17	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	X-Ray Change Room- Sheet flooring, dark brown stone pattern	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the laundry corridor. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Laundry Room	Sample Rep	B51-ASB.17	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	X-Ray Change Room- Sheet flooring, dark brown stone pattern	Transite Pipe, Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the laundry corridor. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Laundry Room	Sample Rep	B51-ASB.2	08-Aug-12	Chrysotile	30%	Transite Pipe	Good	3	Boiler Room- Transite pipe adjacent ladder	Transite Pipe, Asbestos Sheet Flooring	Low	Manage	Asbestos-containing transite pipe was identified in the laundry room. In general, the transite pipe was observed in good condition. It is our recommendation that the transite pipe be managed in place.	
M		Homecare Office	Sample Rep	B51-ASB.17	08-Aug-12	Chrysotile	30%	Asbestos Sheet Flooring	Good	3	X-Ray Change Room- Sheet flooring, dark brown stone pattern	Transite Pipe, Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the homecare office. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Homecare Office	Sample Rep	B51-ASB.2	08-Aug-12	Chrysotile	30%	Transite Pipe	Good	3	Boiler Room- Transite pipe adjacent ladder	Transite Pipe, Asbestos Sheet Flooring	Low	Manage	Asbestos-containing transite pipe was identified in the homecare office. In general, the transite pipe was observed in good condition. It is our recommendation that the transite pipe be managed in place.	