

Norquay Health Centre			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
C		Record Room Crawl Space	Sample	B51-ASB.14	07-Aug-12	None	None	Pipeline Fitting Compound			Record Room Crawl Space- Pipe fitting on small line adjacent pit	No Accessible ACM			No asbestos detected. No action required. No accessible asbestos-containing materials identified. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.	
C		Public Health Crawl Space	Sample	B51-ASB.15	07-Aug-12	Amosite	60%	Debris	Poor	1	Public Health Crawl Space- Debris	Debris	High	Cleanup/Manage	Asbestos debris was identified throughout the Crawlspace of the facility. Although asbestos abatement was completed to remove the bulk asbestos within the various Crawlspace areas, the dislodged material was never cleaned up. It is our recommendation that this Crawlspace area of the facility be substantially cleaned to remove all loose debris. Minor raking of the ground may be necessary to ensure that all material has been collected. The crawlspace should remain off limits until the cleanup has been performed. If entry into the area is required it should be done wearing the proper PPE which is a disposable suit and a hepa-filtered respirator.	
C		Crawlspace in linen closet adj. Nurse Station	Sample Rep	B51-ASB.16	07-Aug-12	Chrysotile	30%	Transite Pipe	Good	3	Corridor adj. 101 and 111- Transite pipe	Transite Pipe	Low	Manage	Asbestos was detected in the transite rainwater leader located within the crawlspace. This material is considered to be a non-friable material and will not produce an elevated airborne fibre release unless vigorously disturbed. It is recommended that this material remain in place until renovations warrant removal.	
C		Autoclave Crawlspace	Sample	B51-ASB.19	07-Aug-12	Chrysotile	50%	Debris	Poor	1	Autoclave Crawlspace- Pipeline fitting debris	Debris	Moderate	Cleanup/Manage	Clean up Debris laying on the ground 15' and 25' southwest of entrance and clean up debris in 3 places between 15' and 35' northeast of entrance	
B		Food Storage	Sample	B51-ASB.17	07-Aug-12	Chrysotile	20%	Pipeline Fitting Compound	Good	3	Food Storage Basement- Pipeline fittings on blue line adjacent stairs	Pipeline Fitting Compound, Vinyl Asbestos Tile	Low	Manage	Asbestos was detected in the pipefitting compound located within food storage. This material was observed in good condition with a low potential for disturbance. It is recommended that this material be managed in place until renovations warrant removal.	
B		Food Storage	Sample	B51-ASB.18	07-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Food Storage Basement- 9" by 9" floor tile, blue with black and white streaks	Pipeline Fitting Compound, Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile located on the stairs. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	1	Boiler Room	Sample	B51-ASB.1	07-Aug-12	None	None	Pipeline Fitting Compound			Boiler Room #1- Pipe fitting on large yellow line near floor level, adjacent stairs	Pipeline Fitting Compound			No accessible asbestos-containing materials detected. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.	
M	1	Boiler Room	Sample	B51-ASB.2	07-Aug-12	None	None	Pipeline Fitting Compound			Boiler Room #1- Pipe fitting on large overhead line adjacent "Gas Fired Boiler System"	Pipeline Fitting Compound			No accessible asbestos-containing materials detected. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.	
M	1	Boiler Room	Sample	B51-ASB.3	07-Aug-12	Chrysotile	20%	Pipeline Fitting Compound	Moderate	2	Boiler Room #1- Damaged pipe fitting on small yellow line along east wall, adjacent blue water tank	Pipeline Fitting Compound	Moderate	Remove	Remove 2 pipe fittings along the east wall adjacent the blue water tank, one of which is slightly damaged	
M	1	Boiler Room	Sample	B51-ASB.4	07-Aug-12	None	None	Pipeline Fitting Compound			Boiler Room #1- Pipe fitting on large line, in the northwest corner, adjacent hot water heaters	Pipeline Fitting Compound				

Norquay Health Centre			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
M	1	Boiler Room	Sample	B51-ASB.5	07-Aug-12	None	None	Pipeline Fitting Compound			Boiler Room #1- Pipe fitting on small "Zone A staff dining" line, along the north wall	Pipeline Fitting Compound				
M	2	Boiler Room	Sample	B51-ASB.6	07-Aug-12	None	None	Vinyl Sheet Flooring			Boiler Room #2- Sheet flooring, large brown stone pattern	Pipeline Fitting Compound				
M	2	Boiler Room	Sample	B51-ASB.7	07-Aug-12	None	None	Pipeline Fitting Compound			Boiler Room #2- Pipe fitting on small "DCWS" line above "Brine Tank"	Pipeline Fitting Compound				
M	2	Boiler Room	Sample	B51-ASB.8	07-Aug-12	None	None	Pipeline Fitting Compound			Boiler Room #2- Pipe fitting on small overhead line adjacent "Westell" gray tank	Pipeline Fitting Compound				
M	117	Res Room	Sample	B51-ASB.9	07-Aug-12	None	None	Vinyl Sheet Flooring			Room 117- Sheet flooring, three toned brown stone pattern	No Accessible ACM			No asbestos detected. No action required. No accessible asbestos-containing materials identified. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.	
M		Sitting Room	Sample	B51-ASB.10	07-Aug-12	None	None	Vinyl Sheet Flooring			Sitting Room- Sheet flooring, three toned dark brown with big stone pattern	No Accessible ACM			No asbestos detected. No action required. No accessible asbestos-containing materials identified. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.	
M		Sitting Room	Sample	B51-ASB.11	07-Aug-12	None	None	Stipple Ceiling Texture			Sitting Room- Stippled ceiling texture	No Accessible ACM				
M		Corridor adjacent Boiler Room #1	Sample	B51-ASB.12	07-Aug-12	None	None	Stipple Ceiling Texture			Corridor adjacent Boiler Room #1- Stippled ceiling texture	No Accessible ACM			No asbestos detected. No action required. No accessible asbestos-containing materials identified. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.	
M		Foyer adjacent Nursing Station #1	Sample	B51-ASB.13	07-Aug-12	None	None	Ceiling Tiles			Foyer adjacent Nursing Station #1- 2' by 4' ceiling tile, small pin holes and small irregular gashes	No Accessible ACM			No asbestos detected. No action required. No accessible asbestos-containing materials identified. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.	
M		Corridor adj. 101 and 111	Sample	B51-ASB.16	07-Aug-12	Chrysotile	30%	Transite Pipe	Good	3	Corridor adj. 101 and 111- Transite pipe	Transite Pipe	Low	Manage	Asbestos was detected in the transite rainwater leader located within the corridor. This material is considered to be a non-friable material and will not produce an elevated airborne fibre release unless vigorously disturbed. It is recommended that this material remain in place until renovations warrant removal.	
M		Corridor adj. Nurse Station #2	Sample Rep	B51-ASB.16	07-Aug-12	Chrysotile	30%	Transite Pipe	Good	3	Corridor adj. 101 and 111- Transite pipe	Transite Pipe	Low	Manage	Asbestos was detected in the transite rainwater leader located within the corridor. This material is considered to be a non-friable material and will not produce an elevated airborne fibre release unless vigorously disturbed. It is recommended that this material remain in place until renovations warrant removal.	