

Mental Health- Pine Building			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
B		Tunnel	Sample	B51-ASB.50	17-Nov-12	Chrysotile	50%	Pipeline Fitting Compound	Good	3	Pine Building- Main Tunnel- Pipeline fitting on small white line, adjacent entry doors	Pipeline Fitting Compound, Lineal Pipe Insulation	Low	Manage		
B		Tunnel	Sample	B51-ASB.51	17-Nov-12	Chrysotile	70%	Lineal Pipe Insulation	Good	3	Pine Building- Main Tunnel- Lineal pipe insulation on small line, in center of tunnel	Pipeline Fitting Compound, Lineal Pipe Insulation	Low	Manage		
B		Paper Storage (Lab Records) Room	Sample	B51-ASB.52	17-Nov-12	Chrysotile	40%	Pipeline Fitting Compound	Good	3	Pine Building- Paper Storage (Lab Records Room)- Pipeline fitting on small white line, adjacent entry door	Pipeline Fitting Compound	Low	Manage		
B		Medical Records Filing Room	Sample Rep	B51-ASB.52	17-Nov-12	Chrysotile	40%	Pipeline Fitting Compound	Moderate	2	Pine Building- Paper Storage (Lab Records Room)- Pipeline fitting on small white line, adjacent entry door	Pipeline Fitting Compound	Moderate	Repair	Repair 3 damaged areas in the middle column, adjacent ducting near ceiling.	
B		(1) Medical Records Filing Room	Sample Rep	B51-ASB.52	17-Nov-12	Chrysotile	40%	Pipeline Fitting Compound	Poor	1	Pine Building- Paper Storage (Lab Records Room)- Pipeline fitting on small white line, adjacent entry door	Vinyl Asbestos Tile, Pipeline Fitting Compound	Moderate	Repair/Remove	Repair damaged fittings above ducting and clean up debris on ducting adjacent entry door. Remove small damaged fitting on tan colored line above desk. Remove asbestos mud compound from tan and white lines 25' from entry door. There may be inaccessible fittings above the ducting, consider any fitting above ducting to be ACM.	
B		(1) Medical Records Filing Room	Sample Rep	B51-ASB.17	17-Nov-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Mental Health- Main Corridor- 9" by 9" floor tile, white with black streak	Vinyl Asbestos Tile, Pipeline Fitting Compound	Low	Manage	Asbestos was detected with in the vinyl floor tile located within the filing. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
B		Sump Pump Room	Sample	B51-ASB.53	17-Nov-12	Chrysotile	40%	Pipeline Fitting Compound	Good	3	Pine building- Sump Pump Room- Pipeline fitting on small line in center of room adjacent ceiling	Pipeline Fitting Compound	Low	Manage	Asbestos-containing fittings were identified in the sump pump room. In general, these fittings were observed in good condition. It is our recommendation that these fittings be managed in place. There maybe be inaccessible fittings above the ducting, consider any fitting above the ducting to be ACM.	
B		Storage Room adjacent Sump Pump Room	Sample Rep	B51-ASB.47	17-Nov-12	Chrysotile	50%	Fireproofing	Good	3	West Building- Storage Room adjacent Sump Pump Room- Fire proofing material hanging from ceiling	Pipeline Fitting Compound, Fireproofing	Low/Mod	Manage	Asbestos fireproofing was found on the ceiling within the storage room. The fireproofing was noted in good condition and intact on the ceiling. It is our recommendation that the fireproofing be managed in place.	
B		Storage Room adjacent Sump Pump Room	Sample Rep	B51-ASB.53	17-Nov-12	Chrysotile	40%	Pipeline Fitting Compound	Good	3	Pine building- Sump Pump Room- Pipeline fitting on small line in center of room adjacent ceiling	Pipeline Fitting Compound, Fireproofing	Low	Manage	Asbestos-containing fittings were identified in the storage room. In general, these fittings were observed in good condition. It is our recommendation that these fittings be managed in place.	

Mental Health- Pine Building			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
B		Radiology Storage	Sample	B51-ASB.54	17-Nov-12	Chrysotile	50%	Pipeline Fitting Compound	Poor	1	Pine Building- Radiology Storage- Pipeline fitting on small line, coming off of unit heater, adjacent unit heater	Pipeline Fitting Compound	Moderate	Repair	Repair damaged fitting along the north wall, in the middle of room. Encapsulate the end of the lineal pipe, where asbestos mud is exposed, adjacent unit heater.	
B		Mechanical Room	Sample	B51-ASB.55	17-Nov-12	Chrysotile	40%	Pipeline Fitting Compound	Poor	1	Pine Building- Mechanical Room- Pipeline fitting on small white line, overhead, adjacent entry doors	Pipeline Fitting Compound, Lineal Pipe Insulation	Mod/High	Repair/Remove	Remove 3 damaged fittings in the northeast corner, and clean up debris in the adjacent area and repair 4 damaged areas in the southeast corner.	
B		Mechanical Room	Sample Rep	B51-ASB.51	17-Nov-12	Chrysotile	70%	Lineal Pipe Insulation	Good	3	Pine Building- Main Tunnel- Lineal pipe insulation on small line, in center of tunnel	Pipeline Fitting Compound, Lineal Pipe Insulation	Low	Manage		
M		Main Floor	Sample Rep	B51-ASB.17	17-Nov-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Mental Health- Main Corridor- 9" by 9" floor tile, white with black streak	Vinyl Asbestos Tile	Low	Manage	Asbestos 9' by 9' floor tile was identified within the corridors, treatment room, and common areas such as the kitchen, laundry room, group meeting room, etc. No patient rooms except for "C-3" contained any accessible ACM. None of the bathrooms or tub rooms contain accessible ACM. Please refer to door jamb labels for which rooms contain ACM on the main floor. The asbestos floor tile was noted in good condition and it is our recommendation that the tiles be managed in place until renovations warrant removal.	
M		Housekeeping Room adjacent Kitchen	Sample Rep	B51-ASB.17	17-Nov-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Mental Health- Main Corridor- 9" by 9" floor tile, white with black streak	Vinyl Asbestos Tile, Heat Shield Material	Low	Manage	Asbestos was detected with in the vinyl floor tile located within the housekeeping room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Housekeeping Room adjacent Kitchen	Sample	B51-ASB.56	17-Nov-12	Chrysotile	60%	Heat Shield Material	Good	3	Pine Building- Housekeeping Room adjacent Kitchen- Heat shield in light fixture	Vinyl Asbestos Tile, Heat Shield Material	Low	Manage	Asbestos heat shield material was identified within the light fixture of the housekeeping room, the heat shield was covered and in good condition. It is our recommendation that the heat shield be managed in place.	