

Preeceville Health Centre			BERSCH & ASSOCIATES LTD.														
			SAMPLE DATA														
Floor	Room Number	Use	SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments		
C		Southwest Crawlspace	Sample	B51-ASB.3	07-Aug-12	Chrysotile	30%	Transite Pipe	Good	3	Crawl Space- Transite Pipe	Transite Pipe	Low	Manage	Asbestos-containing transite pipe was identified in the southwest crawlspace. In general, the transite pipe was observed in good condition. It is our recommendation that the transite pipe be managed in place.		
C		Southwest Crawlspace	Sample	B51-ASB.4	07-Aug-12	None	None	Fireproofing			Crawl Space- Spray applied fireproofing	Transite Pipe			No asbestos detected. No action required.		
C		South Crawl Space	Sample	B51-ASB.5	07-Aug-12	None	None	Debris			South Crawl Space- Debris along centre cement roof column	No Accessible ACM			No asbestos detected. No action required. No accessible asbestos-containing materials identified. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.		
C		South Crawl Space	Sample	B51-ASB.6	07-Aug-12	None	None	Debris			South Crawl Space- Debris along centre cement roof column	No Accessible ACM			No asbestos detected. No action required. No accessible asbestos-containing materials identified. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.		
C		East Crawl Space	Sample	B51-ASB.7	07-Aug-12	None	None	Fireproofing			East Crawl Space- Spray applied fireproofing along south wall	No Accessible ACM			No asbestos detected. No action required. No accessible asbestos-containing materials identified. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.		
B		Boiler Room	Sample	B51-ASB.1	07-Aug-12	None	None	Fireproofing			Boiler Room- Spray applied fireproofing	No Accessible ACM			No asbestos detected. No action required. No accessible asbestos-containing materials identified. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.		
B		Boiler Room	Sample	B51-ASB.2	07-Aug-12	None	None	Pipeline Fitting Compound			Boiler Room- Pipe fitting on medium "Heating Return" line, above green "Nortec" system	No Accessible ACM			No asbestos detected. No action required. No accessible asbestos-containing materials identified. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.		
B		Basement Stairwell	Sample	B51-ASB.8	07-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Stairwell- 12" by 12" floor tile, gray with black spec	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.		
B		Basement Stairwell	Sample	B51-ASB.9	07-Aug-12	None	None	Pipeline Fitting Compound			Basement Stairwell- Pipe fitting on small white line coming from unit heater, adjacent exit door	Vinyl Asbestos Tile			No asbestos detected. No action required. No accessible asbestos-containing materials identified. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.		
M		Clean Linen Storage	Sample	B51-ASB.10	07-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Clean Linen Storage- 12" by 12" floor tile, light brown with dark brown and black streaks	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.		
M		Men's Staff Bathroom	Sample	B51-ASB.11	07-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Men's Staff Bathroom adjacent Basement Entry Door- 12" by 12" floor tile, olive green with black and white spec	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.		

Preeceville Health Centre			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
M		Mechanical Room	Sample	B51-ASB.12	07-Aug-12	None	None	Ceiling Tiles			"Mechanical Room"- 2' by 4' ceiling tile, with two different size pin holes	No Accessible ACM			No asbestos detected. No action required. No accessible asbestos-containing materials identified. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.	
M		Environmental Services	Sample	B51-ASB.13	07-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Environmental Services Room- 12" by 12" floor tile, green with white streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Washroom	Sample	B51-ASB.14	07-Aug-12	None	None	Vinyl Floor Tile			Washroom across from X-ray- 12" by 12" floor tile, dark green with white spec	No Accessible ACM			No asbestos detected. No action required. No accessible asbestos-containing materials identified. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.	
M		Main Clinic Corridor	Sample	B51-ASB.15	07-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Main Clinic Corridor- Sheet flooring, white stone pattern with spots of brown	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the main clinic corridor. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		"CSR" Room	Sample	B51-ASB.16	07-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	CSR Room- 12" by 12" floor tile, gray with dark spec	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Corridor adjacent 402	Sample	B51-ASB.17	24-Sep-12	Chrysotile	20%	Pipeline Fitting Compound	Poor	1	Corridor adjacent 402- Pipe fitting on medium line above ceiling tile adjacent nurses station acute core sign	Pipeline Fitting Compound	Moderate	Repair/Remove	Repair damaged fitting above ceiling tile along north wall close to the nurse station acute sign. Some fittings in corridor maybe be inaccessible to label due to the ducting.	
M	401.3	Waiting Room	Sample	B51-ASB.18	24-Sep-12	Chrysotile	20%	Pipeline Fitting Compound	Poor	1	Waiting Room 401.3- Pipe fitting on small line above ceiling on foil wrapped line	Pipeline Fitting Compound	Moderate	Repair/Remove	Remove damaged pipeline fitting above ceiling tile and clean up debris on ceiling tile	
M		Medical Room	Sample	B51-ASB.19	24-Sep-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Medical Room- 1' by 1' floor tile, brown with brown streaks	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Old Electrical Room	Sample Rep	B51-ASB.3	07-Aug-12	Chrysotile	30%	Transite Pipe	Good	3	Crawl Space- Transite Pipe	Transite Pipe	Low	Manage	Asbestos-containing transite pipe was identified in the old electrical room. In general, the transite pipe was observed in good condition. It is our recommendation that the transite pipe be managed in place.	
M		Dirty Linen	Sample Rep	B51-ASB.8	07-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Stairwell- 12" by 12" floor tile, gray with black spec	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		300 Corridor	Sample Rep	B51-ASB.8	07-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Stairwell- 12" by 12" floor tile, gray with black spec	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	311	Res Room	Sample Rep	B51-ASB.8	07-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Stairwell- 12" by 12" floor tile, gray with black spec	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Lab Office	Sample Rep	B51-ASB.8	07-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Basement Stairwell- 12" by 12" floor tile, gray with black spec	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	

Preeceville Health Centre			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
M		Soiled Linen Room	Sample Rep	B51-ASB.13	07-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	"Environmental Services" Room-12" by 12" floor tile, green with white streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Clean Linen Room	Sample Rep	B51-ASB.10	07-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Clean Linen Storage- 12" by 12" floor tile, light brown with dark brown and black streaks	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Visiting Services # 1	Sample Rep	B51-ASB.10	07-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Clean Linen Storage- 12" by 12" floor tile, light brown with dark brown and black streaks	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		X-ray Storage	Sample Rep	B51-ASB.10	07-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Clean Linen Storage- 12" by 12" floor tile, light brown with dark brown and black streaks	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Delivery Room	Sample Rep	B51-ASB.10	07-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Clean Linen Storage- 12" by 12" floor tile, light brown with dark brown and black streaks	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Scheduling Office	Sample Rep	B51-ASB.10	07-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Clean Linen Storage- 12" by 12" floor tile, light brown with dark brown and black streaks	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Visiting Services # 2	Sample Rep	B51-ASB.10	07-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Clean Linen Storage- 12" by 12" floor tile, light brown with dark brown and black streaks	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Staff Bathroom	Sample Rep	B51-ASB.11	07-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Men's Staff Bathroom adjacent Basement Entry Door- 12" by 12" floor tile, olive green with black and white spec	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Wheel Chair Storage	Sample Rep	B51-ASB.13	07-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	"Environmental Services" Room-12" by 12" floor tile, green with white streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	313	Res Room	Sample Rep	B51-ASB.13	07-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	"Environmental Services" Room-12" by 12" floor tile, green with white streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	304	Res Room	Sample Rep	B51-ASB.13	07-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	"Environmental Services" Room-12" by 12" floor tile, green with white streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	306	Res Room	Sample Rep	B51-ASB.13	07-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	"Environmental Services" Room-12" by 12" floor tile, green with white streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	310	Res Room	Sample Rep	B51-ASB.13	07-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	"Environmental Services" Room-12" by 12" floor tile, green with white streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	303	Res Room	Sample Rep	B51-ASB.10	07-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Clean Linen Storage- 12" by 12" floor tile, light brown with dark brown and black streaks	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	305	Res Room	Sample Rep	B51-ASB.10	07-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Clean Linen Storage- 12" by 12" floor tile, light brown with dark brown and black streaks	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	

Preeceville Health Centre			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
M		Medical Records Room	Sample Rep	B51-ASB.19	24-Sep-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Medical Room- 1' by 1' floor tile, brown with down streaks	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Washroom across from X-ray	Sample Rep	B51-ASB.19	24-Sep-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Medical Room- 1' by 1' floor tile, brown with down streaks	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Nurse Practitioners Office	Sample Rep	B51-ASB.15	07-Aug-12	Chrysotile	40%	Asbestos Sheet Flooring	Good	3	Main Clinic Corridor- Sheet flooring, white stone pattern with spots of brown	Asbestos Sheet Flooring	Low	Manage	Asbestos was detected within the vinyl sheet flooring located within the nurse practitioners office. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Home Care	Sample Rep	B51-ASB.19	24-Sep-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Medical Room- 1' by 1' floor tile, brown with down streaks	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Medical File Storage	Sample Rep	B51-ASB.19	24-Sep-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Medical Room- 1' by 1' floor tile, brown with down streaks	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Administration Office	Sample Rep	B51-ASB.10	07-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Clean Linen Storage- 12" by 12" floor tile, light brown with dark brown and black streaks	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		X-ray Dark Room	Sample Rep	B51-ASB.10	07-Aug-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Clean Linen Storage- 12" by 12" floor tile, light brown with dark brown and black streaks	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Medical Room	Sample Rep	B51-ASB.19	24-Sep-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Medical Room- 1' by 1' floor tile, brown with down streaks	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
P		Penthouse	Sample	B51-ASB.21	24-Sep-12	None	None	Pipeline Fitting Compound			Penthouse- Pipe fitting on medium line below waist near entry door	No Accessible ACM			No asbestos detected. No action required. No accessible asbestos-containing materials identified. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.	
P		Penthouse	Sample	B51-ASB.22	24-Sep-12	None	None	Pipeline Fitting Compound			Penthouse- Pipe fitting on medium line below waist near east wall between the two ducting units	No Accessible ACM			No asbestos detected. No action required. No accessible asbestos-containing materials identified. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.	
P		Penthouse	Sample	B51-ASB.23	24-Sep-12	None	None	Pipeline Fitting Compound			Penthouse- Pipe fitting on small line at waist height near the west wall, between two ducting units	No Accessible ACM			No asbestos detected. No action required. No accessible asbestos-containing materials identified. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.	
P		Penthouse	Sample	B51-ASB.20	24-Sep-12	None	None	Pipeline Fitting Compound			Penthouse- Spray applied fireproofing	No Accessible ACM			No asbestos detected. No action required. No accessible asbestos-containing materials identified. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.	