

St. Anthony's Hospital			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
C		Crawl Space	Sample	B51-ASB.19	02-Aug-12	Chrysotile	40%	Transite Pipe	Good	3	Crawl Space- Transite pipe found in a box adjacent crawl space entrance	Transite Pipe, Pipeline Fitting Compound	Low	Manage	Transite drain pipe was found within the crawl space of the facility. The drain pipe was observed in good condition, and it is our recommendation that the drain pipe be managed in place.	
C		Crawl Space	Sample	B51-ASB.20	02-Aug-12	Chrysotile	40%	Pipeline Fitting Compound	Poor	1	Crawl Space- Pipe fitting on small foil wrapped line	Transite Pipe, Pipeline Fitting Compound	High	Cleanup/Manage	Clean up debris in eight different areas between the boiler room entrances and laundry room entrance. Clean up and repair damaged fittings 15' straight from laundry room entrance, between the two ducts. Remove damaged fittings and clean up debris close the the south wall. Repair and clean up damaged fittings 30' from south wall, between the two rows of cement pillars. Clean up debris and remove damaged fittings along the west wall. Clean up several areas in the northwest corner and along the middle wall, some of the debris was inaccessible to label due to the amount of piping in the area. Clean up and repair damaged fittings below the two wings of the building, at the pipe penetrations and exterior walls. It is our recommendation that any worker entering the crawl space wear a half mask respirator and disposable coveralls.	
B		Boiler Room	Sample	B51-ASB.1	02-Aug-12	None	None	Fireproofing			Boiler Room- Spray on fire proofing on ceiling	Pipeline Fitting Compound, Mud Compound			No asbestos detected. No action required.	
B		Boiler Room	Sample	B51-ASB.2	02-Aug-12	None	None	Pipeline Fitting Compound			Boiler Room- Pipe fitting on medium orange line, adjacent "Vent 1" unit fan	Pipeline Fitting Compound, Mud Compound			No asbestos detected. No action required.	
B		Boiler Room	Sample	B51-ASB.3	02-Aug-12	None	None	Pipeline Fitting Compound			Boiler Room- Pipe fitting on medium purple line below waist, adjacent "Vent 1" unit fan	Pipeline Fitting Compound, Mud Compound			No asbestos detected. No action required.	
B		Boiler Room	Sample	B51-ASB.4	02-Aug-12	None	None	Pipeline Fitting Compound			Boiler Room- Pipe fitting on small overhead light green line adjacent red "Taco" tanks	Pipeline Fitting Compound, Mud Compound			No asbestos detected. No action required.	
B		Boiler Room	Sample	B51-ASB.5	02-Aug-12	None	None	Pipeline Fitting Compound			Boiler Room- Pipe fitting on medium overhead dark green "Heating and Cooling Return" line near west wall, adjacent red "Taco" tanks	Pipeline Fitting Compound, Mud Compound			No asbestos detected. No action required.	
B		Boiler Room	Sample	B51-ASB.6	02-Aug-12	Chrysotile	20%	Pipeline Fitting Compound	Good	3	Boiler Room- Pipe fitting on medium light green line near the ceiling, above boiler #4	Pipeline Fitting Compound, Mud Compound	Low	Manage	Asbestos-containing fittings were identified in the boiler room. In general, these fittings were observed in good condition. It is our recommendation that these fittings be managed in place.	
B		Boiler Room	Sample	B51-ASB.7	02-Aug-12	Chrysotile	10%	Pipeline Fitting Compound	Moderate	2	Boiler Room- Pipe fitting on medium red line 6' from south wall, above old brown hot water heater	Pipeline Fitting Compound, Mud Compound	Low/Mod	Encapsulate	Encapsulate medium red pipeline fitting coming off of "June 2011" hot water storage tank. Red pipeline fittings were sprayed with a white dot instead of a red dot for visibility reasons.	
B		Boiler Room	Sample	B51-ASB.8	02-Aug-12	Chrysotile	15%	Pipeline Fitting Compound	Good	3	Boiler Room- Pipe fitting on medium blue line adjacent sample #7	Pipeline Fitting Compound, Mud Compound	Low	Manage	Asbestos-containing fittings were identified in the boiler room. In general, these fittings were observed in good condition. It is our recommendation that these fittings be managed in place.	

St. Anthony's Hospital			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
B		Boiler Room	Sample	B51-ASB.9	02-Aug-12	None	None	Duct Expansion Gasket			Boiler Room- Duct expansion gasket on gray fan unit along north wall	Pipeline Fitting Compound, Mud Compound			No asbestos detected. No action required.	
B		Boiler Room	Sample	B51-ASB.26	18-Sep-12	None	None	Pipeline Fitting Compound			Boiler Room- Pipe fitting on small orange line, at head height, close to "vent 4" fan unit	Pipeline Fitting Compound, Mud Compound			No asbestos detected. No action required.	
B		Boiler Room	Sample	B51-ASB.27	18-Sep-12	Chrysotile	50%	Mud compound	Good	3	Boiler Room- Mud compound on ducting coming off of "vent #3" fan unit	Pipeline Fitting Compound, Mud Compound	Low	Manage	Asbestos-containing mud compound used for ducting insulation was identified within the boiler room. The mud compound was observed in good condition. It is our recommendation that the mud compound be managed in place.	
B		Washroom adjacent Boiler Room	Sample	B51-ASB.14	02-Aug-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Washroom adjacent Boiler Room- 9" by 9" floor tile, white with black streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile located within the washroom. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
B		Main Corridor	Sample	B51-ASB.11	02-Aug-12	Chrysotile	10%	Pipeline Fitting Compound	Good	3	Main Basement Corridor- Pipe fitting on small line along north wall, adjacent exit sign and light fixture	Pipeline Fitting Compound, Vinyl Asbestos Tile	Low	Manage	Asbestos-containing fittings were identified in the corridor. In general, these fittings were observed in good condition. It is our recommendation that these fittings be managed in place.	
B		Main Corridor	Sample	B51-ASB.12	02-Aug-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Basement Corridor- 9" by 9" floor tile, beige with brownish burgundy streak	Pipeline Fitting Compound, Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the corridor. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
B		Labour Room	Sample Rep	B51-ASB.6	02-Aug-12	Chrysotile	20%	Pipeline Fitting Compound	Good	3	Boiler Room- Pipe fitting on medium light green line near the ceiling, above boiler #4	Pipeline Fitting Compound	Low	Manage	Asbestos-containing fittings were identified in the labour room. In general, these fittings were observed in good condition. It is our recommendation that these fittings be managed in place. There may be inaccessible fittings above the ducting, consider any inaccessible fittings to be ACM.	
B		Electrical Room	Sample Rep	B51-ASB.11	02-Aug-12	Chrysotile	10%	Pipeline Fitting Compound	Good	3	Main Basement Corridor- Pipe fitting on small line along north wall, adjacent exit sign and light fixture	Pipeline Fitting Compound	Low	Manage	Asbestos-containing fittings were identified in the electrical room. In general, these fittings were observed in good condition. It is our recommendation that these fittings be managed in place. There may be inaccessible fittings above the ducting, consider all inaccessible fittings to be ACM.	
B		Storage Room East of Boiler Room	Sample	B51-ASB.10	02-Aug-12	None	None	Mud compound			Storage Room East of Boiler Room- Mud compound from old boiler exhaust vent	Pipeline Fitting Compound			No asbestos detected. No action required.	
B		Storage Room East of Boiler Room	Sample Rep	B51-ASB.11	02-Aug-12	Chrysotile	10%	Pipeline Fitting Compound	Good	3	Main Basement Corridor- Pipe fitting on small line along north wall, adjacent exit sign and light fixture	Pipeline Fitting Compound	Low	Manage	There may be inaccessible fittings above the ducting, consider all inaccessible fittings to be ACM.	
B		Storage Room adjacent Maintenance Office	Sample Rep	B51-ASB.11	02-Aug-12	Chrysotile	10%	Pipeline Fitting Compound	Good	3	Main Basement Corridor- Pipe fitting on small line along north wall, adjacent exit sign and light fixture	Pipeline Fitting Compound, Vinyl Asbestos Tile	Low	Manage	Asbestos-containing fittings were identified in the storage room. In general, these fittings were observed in good condition. It is our recommendation that these fittings be managed in place.	
B		Storage Room adjacent Maintenance Office	Sample Rep	B51-ASB.12	02-Aug-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Basement Corridor- 9" by 9" floor tile, beige with brownish burgundy streak	Pipeline Fitting Compound, Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the storage room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	

St. Anthony's Hospital			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
B		Oxygen Storage	Sample Rep	B51-ASB.12	02-Aug-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Basement Corridor- 9" by 9" floor tile, beige with brownish burgundy streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the storage room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
B		Storage Room adjacent Oxygen Room	Sample Rep	B51-ASB.12	02-Aug-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Basement Corridor- 9" by 9" floor tile, beige with brownish burgundy streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the storage room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
B		HSK Storage	Sample	B51-ASB.13	02-Aug-12	None	None	Ceiling Tiles			HSK Storage- 2' by 2' ceiling tile, with small and large hole	Pipeline Fitting Compound, Vinyl Asbestos Tile, Fire Stop Material			No asbestos detected. No action required.	
B		HSK Storage	Sample Rep	B51-ASB.12	02-Aug-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Basement Corridor- 9" by 9" floor tile, beige with brownish burgundy streak	Pipeline Fitting Compound, Vinyl Asbestos Tile, Fire Stop Material	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the storage room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
B		HSK Storage	Sample	B51-ASB.15	02-Aug-12	Chrysotile	20%	Pipeline Fitting Compound	Moderate	1	HSK Storage- Pipe fitting on small black line above ceiling tile	Pipeline Fitting Compound, Vinyl Asbestos Tile, Fire Stop Material	Mod/High	Cleanup/Manage	Clean up fitting debris from on top of ceiling tile throughout the entire room.	
B		HSK Storage	Sample	B51-ASB.16	02-Aug-12	Chrysotile	25%	Fire-Stop Material	Moderate	1	HSK Storage- Fire stop material at pipe penetration in the northeast corner, above ceiling tile	Pipeline Fitting Compound, Vinyl Asbestos Tile, Fire Stop Material	Mod/High	Remove	Remove fire-stop material at pipe penetrations into the ceiling.	
B		Washroom adjacent HSK Storage	Sample Rep	B51-ASB.14	02-Aug-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Washroom adjacent Boiler Room- 9" by 9" floor tile, white with black streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile located within the washroom. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
B		Board Room	Sample Rep	B51-ASB.30	18-Sep-12	Chrysotile	15%	Pipeline Fitting Compound	Good	3	File Storage- Pipe fitting on small overhead line close to entry door	Pipeline Fitting Compound	Low	Manage	Asbestos-containing fittings were identified in the board room. In general, these fittings were observed in good condition. It is our recommendation that these fittings be managed in place.	
B		File Storage	Sample	B51-ASB.29	18-Sep-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	File Storage- 9" by 9" floor tile, blue with dark blue and white streak	Vinyl Asbestos Tile, Pipeline Fitting Compound	Low	Manage	Asbestos was detected within the vinyl floor tile located within the storage room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
B		File Storage	Sample	B51-ASB.30	18-Sep-12	Chrysotile	15%	Pipeline Fitting Compound	Good	3	File Storage- Pipe fitting on small overhead line close to entry door	Vinyl Asbestos Tile, Pipeline Fitting Compound	Low	Manage	Asbestos-containing fittings were identified in the storage room. In general, these fittings were observed in good condition. It is our recommendation that these fittings be managed in place.	
B		File Storage	Sample Rep	B51-ASB.14	02-Aug-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Washroom adjacent Boiler Room- 9" by 9" floor tile, white with black streak	Vinyl Asbestos Tile, Pipeline Fitting Compound	Low	Manage	Asbestos was detected within the vinyl floor tile located within the storage room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
B		X-Ray Storage	Sample Rep	B51-ASB.30	18-Sep-12	Chrysotile	15%	Pipeline Fitting Compound	Good	3	File Storage- Pipe fitting on small overhead line close to entry door	Vinyl Asbestos Tile, Pipeline Fitting Compound	Low	Manage	Asbestos-containing fittings were identified in the storage room. In general, these fittings were observed in good condition. It is our recommendation that these fittings be managed in place.	
B		X-Ray Storage	Sample Rep	B51-ASB.12	02-Aug-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Basement Corridor- 9" by 9" floor tile, beige with brownish burgundy streak	Vinyl Asbestos Tile, Pipeline Fitting Compound	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the storage room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	

St. Anthony's Hospital			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
B		Laundry Room	Sample	B51-ASB.17	02-Aug-12	Chrysotile	30%	Transite Board	Good	3	Laundry Room- Transite board used for iron holder	Transite Board, Pipeline Fitting Compound	Low/Mod	Manage	Transite board was identified within the laundry room being used as an ironing board. The board was observed in good condition. It is our recommendation that the board be managed in place.	
B		Laundry Room	Sample	B51-ASB.18	02-Aug-12	None	None	Vinyl Sheet Flooring			Laundry Room- Sheet flooring, three toned brown stone pattern, used as a countertop	Transite Board, Pipeline Fitting Compound			No asbestos detected. No action required.	
B		Laundry Room	Sample	B51-ASB.28	18-Sep-12	Chrysotile	10%	Pipeline Fitting Compound	Moderate	2	Laundry Room- Damaged pipe fitting on small overhead line above desk, adjacent ducting	Transite Board, Pipeline Fitting Compound	Moderate	Encapsulate	Encapsulate small damaged pipeline fitting, above the desk, adjacent ducting.	
M		Main Corridor/ Foyer	Sample	B51-ASB.25	02-Aug-12	None	None	Dry Wall			Main Foyer- Dry wall	Vinyl Asbestos Tile, Pipeline Fitting Compound			No asbestos detected. No action required.	
M		Main Corridor/ Foyer	Sample Rep	B51-ASB.23	02-Aug-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Corridor adjacent Chapel- 9" by 9" floor tile, beige with white and brown streak	Vinyl Asbestos Tile, Pipeline Fitting Compound	Low	Manage	Asbestos was detected within the vinyl floor tile located within the corridor. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Main Corridor/ Foyer	Sample	B51-ASB.33	18-Sep-12	Chrysotile	20%	Pipeline Fitting Compound	Poor	1	Main Corridor- Pipe fitting on small line above ceiling tile adjacent "Director of Nursing" office	Vinyl Asbestos Tile, Pipeline Fitting Compound	Mod/High	Clean up	Clean up pipeline fitting debris from on top of ceiling tile, adjacent X-Ray Change Room entry door.	
M		Ladies Public Washroom adjacent Admitting	Sample Rep	B51-ASB.34	18-Sep-12	Chrysotile	80%	Heat Shield Material	Good	3	Storage Room adjacent Room 103- Heat shield in light fixture	Heat Shield Material	Low	Manage	Asbestos containing heat shield was detected within the light fixture within the public washroom. The heat shield was observed in good condition and should managed in place until the light fixture needs to be replaced.	
M		Men's Public Washroom adjacent Admitting	Sample Rep	B51-ASB.34	18-Sep-12	Chrysotile	80%	Heat Shield Material	Good	3	Storage Room adjacent Room 103- Heat shield in light fixture	Heat Shield Material	Low	Manage	Asbestos containing heat shield was detected within the light fixture within the public washroom. The heat shield was observed in good condition and should managed in place until the light fixture needs to be replaced.	
M		Lab	Sample Rep	B51-ASB.12	02-Aug-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Basement Corridor- 9" by 9" floor tile, beige with brownish burgundy streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the lab. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		X-Ray	Sample Rep	B51-ASB.12	02-Aug-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Basement Corridor- 9" by 9" floor tile, beige with brownish burgundy streak	Vinyl Asbestos Tile, Heat Shield Material	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the X-ray room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		X-Ray	Sample Rep	B51-ASB.34	18-Sep-12	Chrysotile	80%	Heat Shield Material	Good	3	Storage Room adjacent Room 103- Heat shield in light fixture	Vinyl Asbestos Tile, Heat Shield Material	Low	Manage	Asbestos containing heat shield was detected within the light fixture within the X-ray room. The heat shield was observed in good condition and should managed in place until the light fixture needs to be replaced.	
M		X-Ray Change Room	Sample Rep	B51-ASB.12	02-Aug-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Basement Corridor- 9" by 9" floor tile, beige with brownish burgundy streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the change room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		X-Ray Office	Sample Rep	B51-ASB.14	02-Aug-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Washroom adjacent Boiler Room- 9" by 9" floor tile, white with black streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile located within the office. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	

St. Anthony's Hospital			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
M		South Storage Room	Sample Rep	B51-ASB.12	02-Aug-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Basement Corridor- 9" by 9" floor tile, beige with brownish burgundy streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the storage room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Serenity Room	Sample Rep	B51-ASB.12	02-Aug-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Basement Corridor- 9" by 9" floor tile, beige with brownish burgundy streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl asbestos floor tile located within the serenity room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Storage Room between Serenity Room and Chapel	Sample Rep	B51-ASB.14	02-Aug-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Washroom adjacent Boiler Room- 9" by 9" floor tile, white with black streak	Vinyl Asbestos Tile, Heat Shield Material	Low	Manage	Asbestos was detected within the vinyl floor tile located within the storage room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Storage Room between Serenity Room and Chapel	Sample Rep	B51-ASB.34	18-Sep-12	Chrysotile	80%	Heat Shield Material	Good	3	Storage Room adjacent Room 103- Heat shield in light fixture	Vinyl Asbestos Tile, Heat Shield Material	Low	Manage	Asbestos containing heat shield was detected within the light fixture within the storage room. The heat shield was observed in good condition and should managed in place until the light fixture needs to be replaced.	
M		Chapel	Sample	B51-ASB.22	02-Aug-12	None	None	Stipple Ceiling Texture			Chapel- Stippled ceiling texture	Vinyl Asbestos Tile, Heat Shield Material			No asbestos detected. No action required.	
M		Chapel	Sample Rep	B51-ASB.14	02-Aug-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Washroom adjacent Boiler Room- 9" by 9" floor tile, white with black streak	Vinyl Asbestos Tile, Heat Shield Material	Low	Manage	Asbestos was detected within the vinyl floor tile located within the chapel. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Chapel	Sample Rep	B51-ASB.34	18-Sep-12	Chrysotile	80%	Heat Shield Material	Good	3	Storage Room adjacent Room 103- Heat shield in light fixture	Vinyl Asbestos Tile, Heat Shield Material	Low	Manage	Asbestos containing heat shield was detected within the light fixture within the chapel. The heat shield was observed in good condition and should managed in place until the light fixture needs to be replaced.	
M		Chapel Closet	Sample	B51-ASB.21	02-Aug-12	None	None	Ceiling Tiles			Chapel Closet- 1' by 1' ceiling tile with tiny pin holes and large irregular gashes	Heat Shield Material			No asbestos detected. No action required.	
M		Chapel Closet	Sample Rep	B51-ASB.34	18-Sep-12	Chrysotile	80%	Heat Shield Material	Good	3	Storage Room adjacent Room 103- Heat shield in light fixture	Heat Shield Material	Low	Manage	Asbestos containing heat shield was detected within the light fixture within the chapel closet. The heat shield was observed in good condition and should managed in place until the light fixture needs to be replaced.	
M		Corridor adjacent Chapel	Sample	B51-ASB.23	02-Aug-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Corridor adjacent Chapel- 9" by 9" floor tile, beige with white and brown streak	Vinyl Asbestos Tile, Pipeline Fitting Compound	Low	Manage	Asbestos was detected within the vinyl floor tile located within the chapel closet. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Corridor adjacent Chapel	Sample	B51-ASB.24	02-Aug-12	Chrysotile	20%	Pipeline Fitting Compound	Poor	1	Corridor adjacent Chapel- Pipe fitting on small line above ceiling tile, adjacent "Serenity Room" entry door	Vinyl Asbestos Tile, Pipeline Fitting Compound	Mod/High	Cleanup/Manage	Clean up pipeline fitting debris laying on top of ceiling tile, adjacent the chapel and the chapel entry door.	
M		Ladies Locker Room	Sample Rep	B51-ASB.14	02-Aug-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Washroom adjacent Boiler Room- 9" by 9" floor tile, white with black streak	Vinyl Asbestos Tile, Heat Shield Material	Low	Manage	Asbestos was detected within the vinyl floor tile located within the locker room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	

St. Anthony's Hospital			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Room	Use	SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments		
M	Ladies Locker Room	Sample Rep	B51-ASB.34	18-Sep-12	Chrysotile	80%	Heat Shield Material	Good	3	Storage Room adjacent Room 103-Heat shield in light fixture	Vinyl Asbestos Tile, Heat Shield Material	Low	Manage	Asbestos containing heat shield was detected within the light fixture within the locker room. The heat shield was observed in good condition and should managed in place until the light fixture needs to be replaced.		
M	Cast Room	Sample Rep	B51-ASB.14	02-Aug-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Washroom adjacent Boiler Room-9" by 9" floor tile, white with black streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile located within the cast room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.		
M	EKG/ Consulting Room	Sample Rep	B51-ASB.14	02-Aug-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Washroom adjacent Boiler Room-9" by 9" floor tile, white with black streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile located within the EKG/ Consulting room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.		
M	I.V Solutions	Sample Rep	B51-ASB.23	02-Aug-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Corridor adjacent Chapel- 9" by 9" floor tile, beige with white and brown streak	Vinyl Asbestos Tile, Heat Shield Material	Low	Manage	Asbestos was detected within the vinyl floor tile located within the I.V Solutions room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.		
M	I.V Solutions	Sample Rep	B51-ASB.34	18-Sep-12	Chrysotile	80%	Heat Shield Material	Good	3	Storage Room adjacent Room 103-Heat shield in light fixture	Vinyl Asbestos Tile, Heat Shield Material	Low	Manage	Asbestos containing heat shield was detected within the light fixture within the I.V Solutions room. The heat shield was observed in good condition and should managed in place until the light fixture needs to be replaced.		
M	Storage Room adjacent I.V Solutions	Sample Rep	B51-ASB.14	02-Aug-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Washroom adjacent Boiler Room-9" by 9" floor tile, white with black streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile located within the storage room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.		
M	Staff Room	Sample Rep	B51-ASB.23	02-Aug-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Corridor adjacent Chapel- 9" by 9" floor tile, beige with white and brown streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile located within the staff room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.		
M	ER1 Closet	Sample Rep	B51-ASB.23	02-Aug-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Corridor adjacent Chapel- 9" by 9" floor tile, beige with white and brown streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile located within the closet. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.		
M	Med Room	Sample Rep	B51-ASB.14	02-Aug-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Washroom adjacent Boiler Room-9" by 9" floor tile, white with black streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile located within the med room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.		
M	Ice Machine Room	Sample Rep	B51-ASB.14	02-Aug-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Washroom adjacent Boiler Room-9" by 9" floor tile, white with black streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile located within the ice machine room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.		
M	Supply Room across from Nursing Station	Sample Rep	B51-ASB.14	02-Aug-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Washroom adjacent Boiler Room-9" by 9" floor tile, white with black streak	Vinyl Asbestos Tile, Pipeline Fitting Compound	Low	Manage	Asbestos was detected within the vinyl floor tile located within the supply room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.		
M	Supply Room across from Nursing Station	Sample	B51-ASB.31	18-Sep-12	Chrysotile	10%	Pipeline Fitting Compound	Poor	1	Supply Room across from Nursing Station- Pipe fitting on small line, above ceiling tile	Vinyl Asbestos Tile, Pipeline Fitting Compound	Mod/High	Clean up	Clean up pipeline fitting debris from on top of ceiling tiles in both rooms.		
M	Corridor adjacent Nursing Station	Sample Rep	B51-ASB.23	02-Aug-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Corridor adjacent Chapel- 9" by 9" floor tile, beige with white and brown streak	Vinyl Asbestos Tile, Pipeline Fitting Compound	Low	Manage	Asbestos was detected within the vinyl floor tile located within the corridor. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.		

St. Anthony's Hospital			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
M		Corridor adjacent Nursing Station	Sample Rep	B51-ASB.24	02-Aug-12	Chrysotile	20%	Pipeline Fitting Compound	Poor	1	Corridor adjacent Chapel- Pipe fitting on small line above ceiling tile, adjacent "Serenity Room" entry door	Vinyl Asbestos Tile, Pipeline Fitting Compound	Mod/High	Clean up	Clean up pipeline fitting debris from on top of ceiling tile adjacent Med. Room. Also clean up debris on top of the ceiling tile on the north side of the nurse station.	
M		ER2	Sample	B51-ASB.32	18-Sep-12	None	None	Vinyl Sheet Flooring			ER2- Sheet flooring, pink stone pattern				No asbestos detected. No action required.	
M		103- 120 Corridor	Sample Rep	B51-ASB.33	18-Sep-12	Chrysotile	20%	Pipeline Fitting Compound	Good	3	Main Corridor- Pipe fitting on small line above ceiling tile adjacent "Director of Nursing" office	Vinyl Asbestos Tile, Pipeline Fitting Compound	Low	Manage	Asbestos-containing fittings were identified in the corridor. In general, these fittings were observed in good condition. It is our recommendation that these fittings be managed in place.	
M		103- 120 Corridor	Sample Rep	B51-ASB.23	02-Aug-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Corridor adjacent Chapel- 9" by 9" floor tile, beige with white and brown streak	Vinyl Asbestos Tile, Pipeline Fitting Compound	Low	Manage	Asbestos was detected within the vinyl floor tile located within the corridor. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		OBS Room	Sample Rep	B51-ASB.35	18-Sep-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Room 106- 9" by 9" floor tile, blue and brown streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile located within the OBS room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Tub Room within OBS Room	Sample Rep	B51-ASB.34	18-Sep-12	Chrysotile	80%	Heat Shield Material	Good	3	Storage Room adjacent Room 103- Heat shield in light fixture	Heat Shield Material	Low	Manage	Asbestos containing heat shield was detected within the light fixture within the tub room. The heat shield was observed in good condition and should be managed in place until the light fixture needs to be replaced.	
M	103	Resident Room	Sample Rep	B51-ASB.23	02-Aug-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Corridor adjacent Chapel- 9" by 9" floor tile, beige with white and brown streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Storage Room adjacent Room 103	Sample Rep	B51-ASB.23	02-Aug-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Corridor adjacent Chapel- 9" by 9" floor tile, beige with white and brown streak	Vinyl Asbestos Tile, Heat Shield Material	Low	Manage	Asbestos was detected within the vinyl floor tile located within the storage room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Storage Room adjacent Room 103	Sample	B51-ASB.34	18-Sep-12	Chrysotile	80%	Heat Shield Material	Good	3	Storage Room adjacent Room 103- Heat shield in light fixture	Vinyl Asbestos Tile, Heat Shield Material	Low	Manage	Asbestos containing heat shield was detected within the light fixture within the storage room. The heat shield was observed in good condition and should be managed in place until the light fixture needs to be replaced.	
M	106	Resident Room	Sample	B51-ASB.35	18-Sep-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Room 106- 9" by 9" floor tile, blue and brown streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	107	Resident Room	Sample Rep	B51-ASB.14	02-Aug-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Washroom adjacent Boiler Room- 9" by 9" floor tile, white with black streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	110	Resident Room	Sample Rep	B51-ASB.35	18-Sep-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Room 106- 9" by 9" floor tile, blue and brown streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	112	Resident Room	Sample Rep	B51-ASB.14	02-Aug-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Washroom adjacent Boiler Room- 9" by 9" floor tile, white with black streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	

St. Anthony's Hospital			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
M	116	Resident Room	Sample Rep	B51-ASB.23	02-Aug-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Corridor adjacent Chapel- 9" by 9" floor tile, beige with white and brown streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	117	Resident Room	Sample Rep	B51-ASB.35	18-Sep-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Room 106- 9" by 9" floor tile, blue and brown streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	129	Resident Room	Sample Rep	B51-ASB.35	18-Sep-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Room 106- 9" by 9" floor tile, blue and brown streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Shower Room adjacent Room 129	Sample Rep	B51-ASB.14	02-Aug-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Washroom adjacent Boiler Room- 9" by 9" floor tile, white with black streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	130	Resident Room	Sample Rep	B51-ASB.35	18-Sep-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Room 106- 9" by 9" floor tile, blue and brown streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		103- 120 Lounge	Sample Rep	B51-ASB.23	02-Aug-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Corridor adjacent Chapel- 9" by 9" floor tile, beige with white and brown streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile located within the resident room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Washroom adjacent Room 168	Sample Rep	B51-ASB.14	02-Aug-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Washroom adjacent Boiler Room- 9" by 9" floor tile, white with black streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile located within the washroom. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Recovery Room	Sample Rep	B51-ASB.14	02-Aug-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Washroom adjacent Boiler Room- 9" by 9" floor tile, white with black streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile located within the recovery room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Linen Room adjacent Recovery Room	Sample Rep	B51-ASB.14	02-Aug-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Washroom adjacent Boiler Room- 9" by 9" floor tile, white with black streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile located within the linen room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Physiotherapy Corridor	Sample	B51-ASB.36	18-Sep-12	Chrysotile	15%	Pipeline Fitting Compound	Good	3	Physiotherapy corridor- Pipe fitting on small line, above ceiling tile, adjacent room 129	Vinyl Asbestos Tile, Pipeline Fitting Compound	Low	Manage	Some pipe fittings within the corridor were inaccessible to label, consider all fittings in the corridor to be ACM.	
M		Physiotherapy Corridor	Sample Rep	B51-ASB.23	02-Aug-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Corridor adjacent Chapel- 9" by 9" floor tile, beige with white and brown streak	Vinyl Asbestos Tile, Pipeline Fitting Compound	Low	Manage	Asbestos was detected within the vinyl floor tile located within the corridor. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Physiotherapy	Sample Rep	B51-ASB.35	18-Sep-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Room 106- 9" by 9" floor tile, blue and brown streak	Vinyl Asbestos Tile	Low	Manage	There are the three closets within physiotherapy that have 9' by 9' floor tile.	
M		Physiotherapy Office	Sample Rep	B51-ASB.35	18-Sep-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Room 106- 9" by 9" floor tile, blue and brown streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile located within the office. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	

St. Anthony's Hospital			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
M		Wheelchair Storage adjacent Physiotherapy	Sample Rep	B51-ASB.14	02-Aug-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Washroom adjacent Boiler Room- 9" by 9" floor tile, white with black streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile located within the wheelchair storage room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Physiotherapy Shower Room	Sample Rep	B51-ASB.34	18-Sep-12	Chrysotile	80%	Heat Shield Material	Good	3	Storage Room adjacent Room 103- Heat shield in light fixture	Heat Shield Material	Low	Manage	Asbestos containing heat shield was detected within the light fixture within the shower room. The heat shield was observed in good condition and should be managed in place until the light fixture needs to be replaced.	
M		Public Health Office Corridor	Sample Rep	B51-ASB.36	18-Sep-12	Chrysotile	15%	Pipeline Fitting Compound	Poor	1	Physiotherapy corridor- Pipe fitting on small line, above ceiling tile, adjacent room 129	Vinyl Asbestos Tile, Pipeline Fitting Compound, Heat Shield Material	Mod/High	Cleanup/Manage	Clean up pipeline fitting debris on top of pipeline above ceiling tile adjacent the dietitian office. Some pipe fittings in the corridor were inaccessible to label, consider all fittings in corridor to be ACM.	
M		Public Health Office Corridor	Sample Rep	B51-ASB.23	02-Aug-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Corridor adjacent Chapel- 9" by 9" floor tile, beige with white and brown streak	Vinyl Asbestos Tile, Pipeline Fitting Compound, Heat Shield Material	Low	Manage	Asbestos was detected within the vinyl floor tile located within the corridor. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Public Health Office Corridor	Sample Rep	B51-ASB.34	18-Sep-12	Chrysotile	80%	Heat Shield Material	Good	3	Storage Room adjacent Room 103- Heat shield in light fixture	Vinyl Asbestos Tile, Pipeline Fitting Compound, Heat Shield Material	Low	Manage	Asbestos containing heat shield was detected within the light fixture within the corridor. The heat shield was observed in good condition and should be managed in place until the light fixture needs to be replaced.	
M		Closet adjacent Public Health Office	Sample Rep	B51-ASB.34	18-Sep-12	Chrysotile	80%	Heat Shield Material	Good	3	Storage Room adjacent Room 103- Heat shield in light fixture	Heat Shield Material	Low	Manage	Asbestos containing heat shield was detected within the light fixture within the office. The heat shield was observed in good condition and should be managed in place until the light fixture needs to be replaced.	
M		Public Health Nurse Office	Sample Rep	B51-ASB.23	02-Aug-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Corridor adjacent Chapel- 9" by 9" floor tile, beige with white and brown streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile located within the office. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Ambulance Office	Sample Rep	B51-ASB.23	02-Aug-12	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Corridor adjacent Chapel- 9" by 9" floor tile, beige with white and brown streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile located within the office. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	