

Mental Health- West Building			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
B		Tunnel	Sample	B51-ASB.44	17-Nov-12	Chrysotile	70%	Lineal Pipe Insulation	Good	3	West Building- Main Tunnel- Lineal pipe insulation on small line, overhead, running along side a small copper pipe	Vinyl Asbestos Tile, Lineal Pipe Insulation, Pipeline Fitting Compound	Low	Manage	Asbestos lineal pipe insulation was identified within the tunnel. Overall, this material was observed in good condition, and may be managed in place until renovations warrant removal.	
B		Tunnel	Sample	B51-ASB.45	17-Nov-12	Chrysotile	30%	Pipeline Fitting Compound	Poor	1	West Building- Main Tunnel- Pipeline fitting on small white line, adjacent Pine Building entry doors	Vinyl Asbestos Tile, Lineal Pipe Insulation, Pipeline Fitting Compound	Moderate	Repair	Repair exposed mud on large "HP-100" line, 25' east of "west" entry doors, adjacent orange braces. Encapsulate small fitting 40' west of "west" entry doors, adjacent ceiling.	
B		Tunnel	Sample Rep	B51-ASB.17	17-Nov-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Mental Health- Main Corridor- 9" by 9" floor tile, white with black streak	Vinyl Asbestos Tile, Lineal Pipe Insulation, Pipeline Fitting Compound	Low	Manage	Asbestos was detected with in the vinyl floor tile located within the office. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
B		Unit Storage	Sample	B51-ASB.46	17-Nov-12	Chrysotile	40%	Pipeline Fitting Compound	Poor	1	West Building- West Unit Storage- Pipeline fitting on small white line adjacent entry doors	Pipeline Fitting Compound	Moderate	Cleanup/Manage	Clean up debris on top of lockers along the south wall.	
B		Sump Pump Room	Sample Rep	B51-ASB.46	17-Nov-12	Chrysotile	40%	Pipeline Fitting Compound	Good	3	West Building- West Unit Storage- Pipeline fitting on small white line adjacent entry doors	Pipeline Fitting Compound	Low	Manage	Asbestos-containing fittings were identified in the sump pump room. In general, these fittings were observed in good condition. It is our recommendation that these fittings be managed in place. There may be inaccessible fittings above the ducting, consider all fittings above ducting to be ACM.	
B		Storage Room adjacent Sump Pump Room	Sample Rep	B51-ASB.46	17-Nov-12	Chrysotile	40%	Pipeline Fitting Compound	Good	3	West Building- West Unit Storage- Pipeline fitting on small white line adjacent entry doors	Pipeline Fitting Compound, Fireproofing	Low	Manage	Asbestos-containing fittings were identified in the storage room. In general, these fittings were observed in good condition. It is our recommendation that these fittings be managed in place.	
B		Storage Room adjacent Sump Pump Room	Sample	B51-ASB.47	17-Nov-12	Chrysotile	50%	Fireproofing	Poor	1	West Building- Storage Room adjacent Sump Pump Room- Fire proofing material hanging from ceiling	Pipeline Fitting Compound, Fireproofing	Mod/High	Remove	Remove all fireproofing material from ceiling, and clean up debris on floor.	
B		Mechanical Room	Sample	B51-ASB.48	17-Nov-12	Chrysotile	60%	Pipeline Fitting Compound	Poor	1	West Building- Mechanical Room- Pipeline fitting on small white "LP- 15" line, overhead, adjacent entry doors	Pipeline Fitting Compound	Moderate	Repair/Remove	Remove section of piping laying on ground in the northeast corner. Repair 1 damaged fitting and clean up debris in the north corner on the east side of the fan units. Repair 4 damaged areas in the southeast corner.	
B		Mechanical Room	Sample	B51-ASB.49	17-Nov-12	Chrysotile	50%	Pipeline Fitting Compound	Good	3	West Building- Mechanical Room- Pipeline fitting on large white "HP- 100" line, in the southeast corner	Pipeline Fitting Compound	Low	Manage	Asbestos-containing fittings were identified in the mechanical room. In general, these fittings were observed in good condition. It is our recommendation that these fittings be managed in place.	
B		South Building Service Storage	Sample Rep	B51-ASB.49	17-Nov-12	Chrysotile	50%	Pipeline Fitting Compound	Poor	1	West Building- Mechanical Room- Pipeline fitting on large white "HP- 100" line, in the southeast corner	Pipeline Fitting Compound	Moderate	Remove	Remove small fitting adjacent the entry door, and remove small fitting along the east wall in the middle of the room, adjacent the ducting.	

Mental Health- West Building			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
B		West Building Service Storage	Sample Rep	B51-ASB.49	17-Nov-12	Chrysotile	50%	Pipeline Fitting Compound	Good	3	West Building- Mechanical Room- Pipeline fitting on large white "HP-100" line, in the southeast corner	Pipeline Fitting Compound	Low	Manage	Asbestos-containing fittings were identified in the storage room. In general, these fittings were observed in good condition. It is our recommendation that these fittings be managed in place.	
M		Main Floor	Sample Rep	B51-ASB.17	17-Nov-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Mental Health- Main Corridor- 9" by 9" floor tile, white with black streak	Vinyl Asbestos Tile	Low	Manage	There were several rooms on the main floor of the building that contains asbestos 9" by 9" floor tile. The floor tile was noted in good condition and may be managed in place until renovations warrant removal. There is also 12" by 12" floor tile on the main floor which does not contain asbestos. Please refer to the door jambs for which rooms contain ACM on the main floor.	
M		Housekeeping Room adjacent Kitchen	Sample Rep	B51-ASB.17	17-Nov-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Mental Health- Main Corridor- 9" by 9" floor tile, white with black streak	Vinyl Asbestos Tile, Heat Shield Material	Low	Manage	Asbestos was detected with in the vinyl floor tile located within the housekeeping room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Housekeeping Room adjacent Kitchen	Sample Rep	B51-ASB.56	17-Nov-12	Chrysotile	60%	Heat Shield Material	Good	3	Pine Building- Housekeeping Room adjacent Kitchen- Heat shield in light fixture	Vinyl Asbestos Tile, Light Fixture Heat Shield Material	Low	Manage	Asbestos heat shield material was identified within the light fixture of the housekeeping room, the heat shield was covered and in good condition. It is our recommendation that the heat shield be managed in place.	