

Yorkton & District Nursing Home			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradenname ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
C		Crawlspace (North 1 Fan Room)	Sample	B51-ASB.19	18-Jun-05	Chrysotile	70%	Fire-Stop Material	Good	3	Basement-crawlspace off of Ventilation Room B7 Fire-stop material above the doorway inside the crawl-space entry	Fire-Stop Material	Low	Manage	Asbestos was detected within the fire-stop material at pipe penetrations located within the crawlspace. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
C		Crawlspace (Dietary & Housekeeping Storage)	Sample Rep	B51-ASB.25	18-Jun-05	Chrysotile/ Crocidolite	25/ 5%	Transite Pipe	Good	3	Basement Dietary & Housekeeping storage room- Transite drainpipe	Transite Pipe	Low	Manage	Asbestos-containing transite pipe was identified in the crawlspace. In general, the transite pipe was observed in good condition. It is our recommendation that the transite pipe be managed in place.	
B		Corridor	Sample	B51-ASB.1	18-Jun-05	Chrysotile	10%	Pipeline Fitting Compound	Good	3	Basement- Small pipeline fitting on the copper pipeline in the corridor at the bottom of the stairs at the rear of the kitchen	Pipeline Fitting Compound, Transite Pipe	Low	Manage	Asbestos-containing fittings were identified in the corridor. In general, these fittings were observed in good condition. It is our recommendation that these fittings be managed in place.	
B		Corridor	Sample Rep	B51-ASB.25	18-Jun-05	Chrysotile/ Crocidolite	25/ 5%	Transite Pipe	Good	3	Basement Dietary & Housekeeping storage room- Transite drainpipe	Pipeline Fitting Compound, Transite Pipe	Low	Manage	Asbestos-containing transite pipe was identified in the corridor. In general, the transite pipe was observed in good condition. It is our recommendation that the transite pipe be managed in place.	
B		Heating Plant	Sample	B51-ASB.26	18-Jun-05	Chrysotile	70%	Pipeline Fitting Compound	Good	3	Basement Heating Plant Room- HWS pipeline fitting above the water meter in the SW corner	Pipeline Fitting Compound, Transite Pipe, Fire-Stop Material	Low	Manage	Asbestos-containing fittings were identified in the heating plant. In general, these fittings were observed in good condition. It is our recommendation that these fittings be managed in place.	
B		Heating Plant	Sample	B51-ASB.27	18-Jun-05	Chrysotile	70%	Pipeline Fitting Compound	Good	3	Basement Heating Plant Room- HWR pipeline fitting adj. entrance in the northeast corner	Pipeline Fitting Compound, Transite Pipe, Fire-Stop Material	Low	Manage	Asbestos-containing fittings were identified in the heating plant. In general, these fittings were observed in good condition. It is our recommendation that these fittings be managed in place.	
B		Heating Plant	Sample Rep	B51-ASB.25	18-Jun-05	Chrysotile/ Crocidolite	25/ 5%	Transite Pipe	Good	3	Basement Dietary & Housekeeping storage room- Transite drainpipe	Pipeline Fitting Compound, Transite Pipe, Fire-Stop Material	Low	Manage	Asbestos-containing transite pipe was identified in the heating plant. In general, the transite pipe was observed in good condition. It is our recommendation that the transite pipe be managed in place.	
B		Heating Plant	Sample Rep	B51-ASB.8	18-Jun-05	Chrysotile	70%	Fire-Stop Material	Good	3	Basement-corridor adjacent workshop Fire-stop material overhead and to the left of the workshop door at the pipeline penetration in the wall	Pipeline Fitting Compound, Transite Pipe, Fire-Stop Material	Low	Manage	Asbestos was detected within the fire-stop material at pipe penetrations located within the heating plant. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
B		North Equipment Room	Sample Rep	B51-ASB.1	18-Jun-05	Chrysotile	10%	Pipeline Fitting Compound	Good	3	Basement- Small pipeline fitting on the copper pipeline in the corridor at the bottom of the stairs at the rear of the kitchen	Pipeline Fitting Compound, Transite Pipe, Duct Gasket	Low	Manage	Asbestos-containing fittings were identified in the north equipment room. In general, these fittings were observed in good condition. It is our recommendation that these fittings be managed in place.	
B		North Equipment Room	Sample Rep	B51-ASB.25	18-Jun-05	Chrysotile/ Crocidolite	25/ 5%	Transite Pipe	Good	3	Basement Dietary & Housekeeping storage room- Transite drainpipe	Pipeline Fitting Compound, Transite Pipe, Duct Gasket	Low	Manage	Asbestos-containing transite pipe was identified in the north equipment room. In general, the transite pipe was observed in good condition. It is our recommendation that the transite pipe be managed in place.	
B		North Equipment Room	Sample	B51-ASB.33	18-Jun-05	Chrysotile	60%	Duct Gasket	Good	3	Basement North Equipment Room Expansion joint gasket material on fan unit ductwork	Pipeline Fitting Compound, Transite Pipe, Duct Gasket	Low	Manage	Asbestos-containing duct gasket was identified in the north equipment room. In general, the gasket was observed in good condition. It is our recommendation that the gasket be managed in place.	
B		Dietary & House Keeping Storage	Sample	B51-ASB.23	18-Jun-05	Chrysotile	40%	Pipeline Fitting Compound	Good	3	Basement crawlspace off of Dietary & Housekeeping Storage Room-small pipeline fitting to the right of the crawlspace entrance	Pipeline Fitting Compound, Transite Pipe	Low	Manage	Asbestos-containing fittings were identified in the dietary and house keeping storage. In general, these fittings were observed in good condition. It is our recommendation that these fittings be managed in place.	

Yorkton & District Nursing Home			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Room	Use	SAMPLE	Sample	Date	Asbestos	% of	Tradename			Description of	Asbestos Content	Potential for	Recommended			
Floor	Number	Use	SAMPLE REP	ID	DD/MM/YY	Type	Asbestos	ACM Product	Condition	Priority	Sample Location	In Area	Disturbance	Action	Comments	
B		Dietary & House Keeping Storage	Sample Rep	B51-ASB.25	18-Jun-05	Chrysotile/ Crocidolite	25/ 5%	Transite Pipe	Good	3	Basement Dietary & Housekeeping storage room- Transite drainpipe	Pipeline Fitting Compound, Transite Pipe	Low	Manage	Asbestos-containing transite pipe was identified in the dietary & house keeping storage. In general, the transite pipe was observed in good condition. It is our recommendation that the transite pipe be managed in place.	
B		Northwest Stairwell adj Heating Plant	Sample Rep	B51-ASB.23	18-Jun-05	Chrysotile	40%	Pipeline Fitting Compound	Good	3	Basement crawlspace off of Dietary & Housekeeping Storage Room-small pipeline fitting to the right of the crawlspace entrance	Pipeline Fitting Compound, Vinyl Asbestos Tile	Low	Manage	Asbestos-containing fittings were identified in the northwest stairwell. In general, these fittings were observed in good condition. It is our recommendation that these fittings be managed in place.	
B		Northwest Stairwell adj Heating Plant	Sample Rep	B51-ASB.30	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-D wing staff dining room 1' X 1' grey/brown streak floor tile	Pipeline Fitting Compound, Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
B		Men's Lounge	Sample	B51-ASB.7	18-Jun-05	Chrysotile	40%	Pipeline Fitting Compound	Poor	1	Basement-men's lounge Pipeline fitting above the suspended ceiling adj. the radiant heat	Pipeline Fitting Compound, Vinyl Asbestos Tile, Transite Pipe	Moderate	Cleanup/Manage	Repair/ remove damaged pipeline fittings and clean up debris laying on ceiling tile.	
B		Men's Lounge	Sample Rep	B51-ASB.25	18-Jun-05	Chrysotile/ Crocidolite	25/ 5%	Transite Pipe	Good	3	Basement Dietary & Housekeeping storage room- Transite drainpipe	Pipeline Fitting Compound, Vinyl Asbestos Tile, Transite Pipe	Low	Manage	Asbestos-containing transite pipe was identified in the men's lounge. In general, the transite pipe was observed in good condition. It is our recommendation that the transite pipe be managed in place.	
B		Men's Lounge	Sample Rep	B51-ASB.2	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-white/green streak 1' X 1' floor tile at the top landing of the stairwell at the rear of the kitchen	Pipeline Fitting Compound, Vinyl Asbestos Tile, Transite Pipe	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
B		Women's Washroom	Sample Rep	B51-ASB.7	18-Jun-05	Chrysotile	40%	Pipeline Fitting Compound	Good	3	Basement-men's lounge Pipeline fitting above the suspended ceiling adj. the radiant heat	Pipeline Fitting Compound, Vinyl Asbestos Tile	Low	Manage	Asbestos-containing fittings were identified in the women's washroom. In general, these fittings were observed in good condition. It is our recommendation that these fittings be managed in place.	
B		Women's Washroom	Sample Rep	B51-ASB.2	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-white/green streak 1' X 1' floor tile at the top landing of the stairwell at the rear of the kitchen	Pipeline Fitting Compound, Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
B		Housekeeping	Sample Rep	B51-ASB.2	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-white/green streak 1' X 1' floor tile at the top landing of the stairwell at the rear of the kitchen	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
B		Natural Gas Room	Sample Rep	B51-ASB.2	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Poor	2	Main Level-white/green streak 1' X 1' floor tile at the top landing of the stairwell at the rear of the kitchen	Pipeline Fitting Compound, Vinyl Asbestos Tile	Low	Remove	Remove any loose floor tile.	
B		Natural Gas Room	Sample Rep	B51-ASB.6	18-Jun-05	Chrysotile	30%	Pipeline Fitting Compound	Good	3	Basement-electrical room- Overhead pipeline fitting above T-01 transformer adjacent the light fixture	Pipeline Fitting Compound, Vinyl Asbestos Tile	Low	Manage	Asbestos-containing fittings were identified in the natural gas room. In general, these fittings were observed in good condition. It is our recommendation that these fittings be managed in place.	
B		Electrical Room	Sample	B51-ASB.6	18-Jun-05	Chrysotile	30%	Pipeline Fitting Compound	Good	3	Basement-electrical room- Overhead pipeline fitting above T-01 transformer adjacent the light fixture	Pipeline Fitting Compound	Low	Manage	Asbestos-containing fittings were identified in the electrical room. In general, these fittings were observed in good condition. It is our recommendation that these fittings be managed in place.	
B		Workshop Equipment Room	Sample Rep	B51-ASB.9	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Basement-women's locker room 1' X 1' white/black fine streak floor tile	Vinyl Asbestos Tile, Fire- Stop Material	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	

Yorkton & District Nursing Home			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
B		Workshop Equipment Room	Sample Rep	B51-ASB.8	18-Jun-05	Chrysotile	70%	Fire-Stop Material	Good	3	Basement-corridor adjacent workshop Fire-stop material overhead and to the left of the workshop door at the pipeline penetration in the wall	Vinyl Asbestos Tile, Fire-Stop Material	Low	Manage	Asbestos was detected within the fire-stop material at pipe penetrations located within the workshop equipment room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
B		Female Locker Room	Sample	B51-ASB.11	18-Jun-05	Chrysotile	70%	Fire-Stop Material	Good	3	Basement-women's locker room Fire-stop material in pipeline penetration in the ceiling	Vinyl Asbestos Tile, Fire-Stop Material	Low	Manage	Asbestos was detected within the fire-stop material at pipe penetrations located within the female locker room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
B		Female Locker Room	Sample	B51-ASB.9	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Basement-women's locker room 1' X 1' white/black fine streak floor tile	Vinyl Asbestos Tile, Fire-Stop Material	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
B		Craft Storage	Sample Rep	B51-ASB.9	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Basement-women's locker room 1' X 1' white/black fine streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
B		North 1 Fan Room	Sample Rep	B51-ASB.19	18-Jun-05	Chrysotile	70%	Fire-Stop Material	Good	3	Basement-crawlspace off of Ventilation Room B7 Fire-stop material above the doorway inside the crawl-space entry	Fire-Stop Material	Low	Manage	Asbestos was detected within the fire-stop material at pipe penetrations located within the north 1 fan room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
B		Furniture Storage	Sample Rep	B51-ASB.19	18-Jun-05	Chrysotile	70%	Fire-Stop Material	Good	3	Basement-crawlspace off of Ventilation Room B7 Fire-stop material above the doorway inside the crawl-space entry	Vinyl Asbestos Tile, Fire-Stop Material	Low	Manage	Asbestos was detected within the fire-stop material at pipe penetrations located within the furniture storage room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
B		Furniture Storage	Sample Rep	B51-ASB.9	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Basement-women's locker room 1' X 1' white/black fine streak floor tile	Vinyl Asbestos Tile, Fire-Stop Material	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
B		Nursing Storage	Sample Rep	B51-ASB.19	18-Jun-05	Chrysotile	70%	Fire-Stop Material	Good	3	Basement-crawlspace off of Ventilation Room B7 Fire-stop material above the doorway inside the crawl-space entry	Vinyl Asbestos Tile, Fire-Stop Material	Low	Manage	Asbestos was detected within the fire-stop material at pipe penetrations located within the nursing storage room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
B		Nursing Storage	Sample Rep	B51-ASB.9	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Basement-women's locker room 1' X 1' white/black fine streak floor tile	Vinyl Asbestos Tile, Fire-Stop Material	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
B		Storage Room	Sample Rep	B51-ASB.19	18-Jun-05	Chrysotile	70%	Fire-Stop Material	Good	3	Basement-crawlspace off of Ventilation Room B7 Fire-stop material above the doorway inside the crawl-space entry	Fire-Stop Material	Low	Manage	Asbestos was detected within the fire-stop material at pipe penetrations located within the storage room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
B		Corridor adj Storage Room	Sample	B51-ASB.8	18-Jun-05	Chrysotile	70%	Fire-Stop Material	Good	3	Basement-corridor adjacent workshop Fire-stop material overhead and to the left of the workshop door at the pipeline penetration in the wall	Vinyl Asbestos Tile, Fire-Stop Material	Low	Manage	Asbestos was detected within the fire-stop material at pipe penetrations located within the corridor adj storage room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
B		Corridor adj Storage Room	Sample Rep	B51-ASB.9	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Basement-women's locker room 1' X 1' white/black fine streak floor tile	Vinyl Asbestos Tile, Fire-Stop Material	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	101	Res Room A Wing	Sample Rep	B51-ASB.30	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-D wing staff dining room 1' X 1' grey/brown streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	

Yorkton & District Nursing Home			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
M	105	Res Room A Wing	Sample Rep	B51-ASB.30	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-D wing staff dining room 1' X 1' grey/brown streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	107	Res Room A Wing	Sample Rep	B51-ASB.29	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-C 140 1' X 1' grey/lt green streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	108	Res Room A Wing	Sample Rep	B51-ASB.29	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-C 140 1' X 1' grey/lt green streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	109	Res Room A Wing	Sample Rep	B51-ASB.30	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-D wing staff dining room 1' X 1' grey/brown streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	110	Res Room A Wing	Sample Rep	B51-ASB.30	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-D wing staff dining room 1' X 1' grey/brown streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	111	Res Room A Wing	Sample Rep	B51-ASB.29	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-C 140 1' X 1' grey/lt green streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	112	Res Room A Wing	Sample Rep	B51-ASB.29	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-C 140 1' X 1' grey/lt green streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	113	Res Room A Wing	Sample Rep	B51-ASB.30	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-D wing staff dining room 1' X 1' grey/brown streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	114	Res Room A Wing	Sample Rep	B51-ASB.30	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-D wing staff dining room 1' X 1' grey/brown streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	117	Res Room A Wing	Sample Rep	B51-ASB.30	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-D wing staff dining room 1' X 1' grey/brown streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	118	Res Room A Wing	Sample Rep	B51-ASB.30	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-D wing staff dining room 1' X 1' grey/brown streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Sun Room A Wing	Sample Rep	B51-ASB.29	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-C 140 1' X 1' grey/lt green streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	119	Res Room B Wing	Sample Rep	B51-ASB.30	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-D wing staff dining room 1' X 1' grey/brown streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	123	Res Room B Wing	Sample Rep	B51-ASB.30	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-D wing staff dining room 1' X 1' grey/brown streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	124	Res Room B Wing	Sample Rep	B51-ASB.30	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-D wing staff dining room 1' X 1' grey/brown streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	

Yorkton & District Nursing Home			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
M	125	Res Room B Wing	Sample Rep	B51-ASB.29	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-C 140 1' X 1' grey/lt green streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	127	Res Room B Wing	Sample Rep	B51-ASB.30	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-D wing staff dining room 1' X 1' grey/brown streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	128	Res Room B Wing	Sample Rep	B51-ASB.30	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-D wing staff dining room 1' X 1' grey/brown streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	129	Res Room B Wing	Sample Rep	B51-ASB.29	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-C 140 1' X 1' grey/lt green streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	130	Res Room B Wing	Sample Rep	B51-ASB.29	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-C 140 1' X 1' grey/lt green streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	131	Res Room B Wing	Sample Rep	B51-ASB.30	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-D wing staff dining room 1' X 1' grey/brown streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	133	Res Room B Wing	Sample Rep	B51-ASB.30	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-D wing staff dining room 1' X 1' grey/brown streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	134	Res Room B Wing	Sample Rep	B51-ASB.30	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-D wing staff dining room 1' X 1' grey/brown streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Linen B Wing	Sample Rep	B51-ASB.2	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-white/green streak 1' X 1' floor tile at the top landing of the stairwell at the rear of the kitchen	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Office across from 137 C Wing	Sample Rep	B51-ASB.30	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-D wing staff dining room 1' X 1' grey/brown streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	137	Res Room C Wing	Sample Rep	B51-ASB.30	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-D wing staff dining room 1' X 1' grey/brown streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	138	Res Room C Wing	Sample Rep	B51-ASB.30	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-D wing staff dining room 1' X 1' grey/brown streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	139	Res Room C Wing	Sample Rep	B51-ASB.29	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-C 140 1' X 1' grey/lt green streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	140	Res Room C Wing	Sample Rep	B51-ASB.29	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-C 140 1' X 1' grey/lt green streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	141	Res Room C Wing	Sample Rep	B51-ASB.29	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-C 140 1' X 1' grey/lt green streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	

Yorkton & District Nursing Home			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
M	143	Res Room C Wing	Sample Rep	B51-ASB.30	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-D wing staff dining room 1' X 1' grey/brown streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	144	Res Room C Wing	Sample Rep	B51-ASB.30	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-D wing staff dining room 1' X 1' grey/brown streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	145	Res Room C Wing	Sample Rep	B51-ASB.29	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-C 140 1' X 1' grey/lt green streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	146	Res Room C Wing	Sample Rep	B51-ASB.29	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-C 140 1' X 1' grey/lt green streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	147	Res Room C Wing	Sample Rep	B51-ASB.30	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-D wing staff dining room 1' X 1' grey/brown streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	148	Res Room C Wing	Sample Rep	B51-ASB.30	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-D wing staff dining room 1' X 1' grey/brown streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	149	Res Room C Wing	Sample Rep	B51-ASB.29	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-C 140 1' X 1' grey/lt green streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	150	Res Room C Wing	Sample Rep	B51-ASB.29	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-C 140 1' X 1' grey/lt green streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Linen C Wing	Sample Rep	B51-ASB.2	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-white/green streak 1' X 1' floor tile at the top landing of the stairwell at the rear of the kitchen	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Entry into D Wing	Sample Rep	B51-ASB.32	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-Clean Linen room 1' X 1' white/black streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Corridor D Wing	Sample Rep	B51-ASB.32	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-Clean Linen room 1' X 1' white/black streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Data Closet D Wing	Sample Rep	B51-ASB.32	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-Clean Linen room 1' X 1' white/black streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Stairwell across from Kitchen D Wing	Sample Rep	B51-ASB.32	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-Clean Linen room 1' X 1' white/black streak floor tile	Vinyl Asbestos Tile, Heat Shield Material	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Stairwell across from Kitchen D Wing	Sample Rep	B51-ASB.3	18-Jun-05	Chrysotile	70%	Heat Shield Material	Good	3	Basement-corridor adjacent dietary & housekeeping Incandescent light fixture heat shield material	Vinyl Asbestos Tile, Heat Shield Material	Low	Manage	If Damaged, remove exposed heat shields from light fixtures.	
M		Kitchen Stairwell	Sample	B51-ASB.2	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-white/green streak 1' X 1' floor tile at the top landing of the stairwell at the rear of the kitchen	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	

Yorkton & District Nursing Home			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
M		Kitchen D Wing	Sample Rep	B51-ASB.32	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-Clean Linen room 1' X 1' white/black streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Soiled Linen D Wing	Sample Rep	B51-ASB.32	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-Clean Linen room 1' X 1' white/black streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Clean Linen D Wing	Sample	B51-ASB.32	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-Clean Linen room 1' X 1' white/black streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Laundry D Wing	Sample Rep	B51-ASB.32	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-Clean Linen room 1' X 1' white/black streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Sewing Room D Wing	Sample Rep	B51-ASB.32	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-Clean Linen room 1' X 1' white/black streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Cafeteria D Wing	Sample Rep	B51-ASB.32	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-Clean Linen room 1' X 1' white/black streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Craft Room D Wing	Sample Rep	B51-ASB.32	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-Clean Linen room 1' X 1' white/black streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Common Area D Wing	Sample Rep	B51-ASB.32	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-Clean Linen room 1' X 1' white/black streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Staff Dinning D Wing	Sample Rep	B51-ASB.30	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-D wing staff dining room 1' X 1' grey/brown streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Rear Entrance to Kitchen	Sample Rep	B51-ASB.3	18-Jun-05	Chrysotile	70%	Heat Shield Material	Good	3	Basement-corridor adjacent dietary & housekeeping Incandescent light fixture heat shield material	Heat Shield Material	Low	Manage	If Damaged, remove exposed heat shields from light fixtures.	
M		THE ENTIRE E- WING	Sample Rep	B51-ASB.32	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-Clean Linen room 1' X 1' white/black streak floor tile	Vinyl Asbestos Tile	Low	Manage	All rooms within the E-wing, including corridor, have vinyl asbestos tile except clean linen and tub room.	
M	221	Res Room F Wing	Sample Rep	B51-ASB.32	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-Clean Linen room 1' X 1' white/black streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	222	Res Room F Wing	Sample Rep	B51-ASB.32	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-Clean Linen room 1' X 1' white/black streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	223	Res Room F Wing	Sample Rep	B51-ASB.32	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-Clean Linen room 1' X 1' white/black streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	224	Res Room F Wing	Sample Rep	B51-ASB.32	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-Clean Linen room 1' X 1' white/black streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	

Yorkton & District Nursing Home			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
M	238	Res Room F Wing	Sample Rep	B51-ASB.32	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-Clean Linen room 1' X 1' white/black streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	239	Res Room F Wing	Sample Rep	B51-ASB.32	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-Clean Linen room 1' X 1' white/black streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	240	Res Room F Wing	Sample Rep	B51-ASB.32	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-Clean Linen room 1' X 1' white/black streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Service Room F Wing	Sample Rep	B51-ASB.32	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-Clean Linen room 1' X 1' white/black streak floor tile	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected within the vinyl floor tile. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		THE ENTIRE G- WING	Sample Rep	B51-ASB.32	18-Jun-05	Chrysotile	1 to 5%	Vinyl Asbestos Tile	Good	3	Main Level-Clean Linen room 1' X 1' white/black streak floor tile	Vinyl Asbestos Tile	Low	Manage	All rooms within the G-wing have vinyl asbestos tile.	