

Mental Health Building			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
B		Tunnel from Hospital to Mental Health	Sample	B51-ASB.13	17-Nov-12	Chrysotile	50%	Pipeline Fitting Compound	Poor/Mod	1	Mental Health- Tunnel from Hospital to Mental Health- Pipeline fitting on medium line, adjacent exit sign	Pipeline Fitting Compound	Moderate	Repair/Remove	Repair/ Remove exposed mud compound on the large white line, running along the south wall, in several areas.	
B		East Electrical Room	Sample	B51-ASB.14	17-Nov-12	Amosite	60%	Fireproofing	Poor	1	Mental Health- East Electrical Room- Fireproofing on ceiling	Pipeline Fitting Compound, Fireproofing	High	Remove	Clean up all debris within room on all surfaces. Due to the high amount of amosite in the fireproofing either remove or encapsulate the fireproofing on the ceiling.	
B		East Electrical Room	Sample Rep	B51-ASB.13	17-Nov-12	Chrysotile	50%	Pipeline Fitting Compound	Good	3	Mental Health- Tunnel from Hospital to Mental Health- Pipeline fitting on medium line, adjacent exit sign	Pipeline Fitting Compound, Fireproofing	Low	Manage	Asbestos-containing fittings were identified in the electrical room. In general, these fittings were observed in good condition. It is our recommendation that these fittings be managed in place.	
B		North Corridor	Sample	B51-ASB.1	17-Nov-12	Chrysotile	50%	Pipeline Fitting Compound	Good	3	Mental Health- North Basement Corridor- Pipeline fitting on small white line, above ceiling tile, adjacent conference room B2	Pipeline Fitting Compound	Low	Manage	Asbestos-containing fittings were identified in the corridor. In general, these fittings were observed in good condition. It is our recommendation that these fittings be managed in place. Not all fittings within the basement corridors were accessible to identify due to the ducting and limited ceiling space, consider any fitting above ducting to the ACM.	
B		North Corridor	Sample	B51-ASB.2	17-Nov-12	Chrysotile	40%	Pipeline Fitting Compound	Poor	1	Mental Health- North Basement Corridor- Pipeline fitting on medium line, above ceiling tile, in the same area as sample #1	Pipeline Fitting Compound	Moderate	Cleanup/Manage	Clean up debris on ceiling tile, adjacent office entry door and northeast stairwell.	
B		North Corridor	Sample	B51-ASB.3	17-Nov-12		None	Ceiling Tiles			Mental Health- North Basement Corridor- 2' by 4' ceiling tile, with tiny irregular dot pattern	Pipeline Fitting Compound			No asbestos detected. No action required.	
B		East Corridor	Sample	B51-ASB.16	17-Nov-12	Chrysotile	50%	Pipeline Fitting Compound	Poor	1	Mental Health- East Basement Corridor- Pipeline fitting on small line, above ceiling tile, adjacent room 005	Pipeline Fitting Compound	Moderate	Remove	Remove damaged fitting and clean up debris on ceiling tile, adjacent room "009". Not all fittings within the basement corridors were accessible to identify due to the ducting and limited ceiling space, consider all fittings above ducting to be ACM.	
B		South Corridor	Sample Rep	B51-ASB.16	17-Nov-12	Chrysotile	50%	Pipeline Fitting Compound	Good	3	Mental Health- East Basement Corridor- Pipeline fitting on small line, above ceiling tile, adjacent room 005	Pipeline Fitting Compound	Low	Manage	Asbestos-containing fittings were identified in the corridor. In general, these fittings were observed in good condition. It is our recommendation that these fittings be managed in place. Not all fittings within the basement corridors were accessible to identify due to the ducting and limited ceiling space, consider all fittings above ducting to be ACM.	
B		West Corridor	Sample Rep	B51-ASB.16	17-Nov-12	Chrysotile	50%	Pipeline Fitting Compound	Good	3	Mental Health- East Basement Corridor- Pipeline fitting on small line, above ceiling tile, adjacent room 005	Pipeline Fitting Compound	Low	Manage	Asbestos-containing fittings were identified in the corridor. In general, these fittings were observed in good condition. It is our recommendation that these fittings be managed in place. Not all fittings within the basement corridors were accessible to identify due to the ducting and limited ceiling space, consider all fittings above ducting to be ACM.	

Mental Health Building			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
B		Conference Room B2	Sample	B51-ASB.15	17-Nov-12	Chrysotile	40%	Pipeline Fitting Compound	Good	3	Mental Health- Conference Room B2- Pipeline fitting on small line, above ceiling tile, in middle of room	Pipeline Fitting Compound	Low	Manage	Asbestos-containing fittings were identified in the conference room. In general, these fittings were observed in good condition. There were some inaccessible fittings above the ducting above the ceiling tile, consider all fittings within room to be ACM.	
B		Server Room	Sample Rep	B51-ASB.17	17-Nov-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Mental Health- Main Corridor- 9" by 9" floor tile, white with black streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected with in the vinyl floor tile located within the server. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
B		IT Tech Room	Sample Rep	B51-ASB.15	17-Nov-12	Chrysotile	40%	Pipeline Fitting Compound	Good	3	Mental Health- Conference Room B2- Pipeline fitting on small line, above ceiling tile, in middle of room	Pipeline Fitting Compound	Low	Manage	Asbestos-containing fittings were identified in the tech room. In general, these fittings were observed in good condition. There were some inaccessible fittings above the ducting above the ceiling tile, consider all fittings within room to be ACM.	
B		Southwest IT Storage										Pipeline Fitting Compound above enclosed ceiling			Pipeline fittings were seen above the closed ceiling within the IT storage room, but were inaccessible to label or identify, consider fittings above the closed ceiling to be ACM.	
B		Mechanical Room	Sample	B51-ASB.4	17-Nov-12	Chrysotile	60%	Mud compound	Good	3	Mental Health- Basement Mechanical Room- Mud compound from white tank in the northeast corner of room	Mud Compound, Pipeline Fitting Compound	Low	Manage	The mud compound on the tank in the northwest corner was observed in good condition and it is our recommendation that the mud compound be managed in place.	
B		Mechanical Room	Sample	B51-ASB.5	17-Nov-12	Chrysotile	60%	Pipeline Fitting Compound	Good	3	Mental Health- Basement Mechanical Room- Pipeline fitting on large white "LP-15" above head, adjacent removed fitting	Mud Compound, Pipeline Fitting Compound	Low	Manage	Asbestos-containing fittings were identified in the mechanical room. In general, these fittings were observed in good condition. It is our recommendation that these fittings be managed in place.	
B		Mechanical Room	Sample	B51-ASB.6	17-Nov-12		None	Pipeline Fitting Compound			Mental Health- Basement Mechanical Room- Pipeline fitting on medium white line, directly above sample #5	Mud Compound, Pipeline Fitting Compound			No asbestos detected. No action required.	
B		Mechanical Room	Sample	B51-ASB.7	17-Nov-12		None	Pipeline Fitting Compound			Mental Health- Basement Mechanical Room- Damaged pipeline fitting on large line in the northeast corner, above head, adjacent cement pillar	Mud Compound, Pipeline Fitting Compound			No asbestos detected. No action required.	
B		Mechanical Room	Sample	B51-ASB.8	17-Nov-12		None	Pipeline Fitting Compound			Mental Health- Basement Mechanical Room- Pipeline fitting on small "LPC" line, 10' from west entry door	Mud Compound, Pipeline Fitting Compound			No asbestos detected. No action required.	

Mental Health Building			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
B		Mechanical Room	Sample	B51-ASB.9	17-Nov-12	Chrysotile	30%	Pipeline Fitting Compound	Poor	1	Mental Health- Basement Mechanical Room- Pipeline fitting on small line, coming off of blue box along west wall	Mud Compound, Pipeline Fitting Compound	Moderate	Repair/Remove	Repair/ Remove 2 damaged fittings above the blue box along the west wall adjacent the ducting, and 2 damaged fittings in the northwest corner. Remove the section of pipe insulation directly above the blue box which has 5 damaged areas.	
B		Mechanical Room	Sample	B51-ASB.10	17-Nov-12	Chrysotile	50%	Pipeline Fitting Compound	Poor	1	Mental Health- Basement Mechanical Room- Pipeline fitting on large line in the northwest corner, at waist height, adjacent big red valve	Mud Compound, Pipeline Fitting Compound	Mod/High	Repair/Remove	Repair/ Remove 5 damaged areas along the south wall, and 6 damaged areas along the east, south of the white tank where asbestos mud compound is exposed.	
B		Mechanical Room	Sample	B51-ASB.11	17-Nov-12	Chrysotile	30%	Pipeline Fitting Compound	Good	3	Mental Health- Basement Mechanical Room- Pipeline fitting on small white line 10' from east entry door, overhead adjacent red valve	Mud Compound, Pipeline Fitting Compound	Low	Manage	There were some inaccessible fittings in the northwest corner above the ducting, along the south wall adjacent the ducting, as well as along the east wall adjacent the ducting close to the ceiling, that we could not mark or identify. Consider all fittings in these areas to be ACM.	
M		Main Corridor	Sample	B51-ASB.12	17-Nov-12		None	Ceiling Tiles			Mental Health- Main Corridor- 1' by 1' ceiling tile, with small and tiny pin holes	Vinyl Asbestos Tile			No asbestos detected. No action required.	
M		Main Corridor	Sample	B51-ASB.17	17-Nov-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Mental Health- Main Corridor- 9" by 9" floor tile, white with black streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected with in the vinyl floor tile located within the corridor. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	101	Office	Sample Rep	B51-ASB.17	17-Nov-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Mental Health- Main Corridor- 9" by 9" floor tile, white with black streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected with in the vinyl floor tile located within the office. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	102	Office	Sample Rep	B51-ASB.17	17-Nov-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Mental Health- Main Corridor- 9" by 9" floor tile, white with black streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected with in the vinyl floor tile located within the office. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	103	Office	Sample Rep	B51-ASB.17	17-Nov-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Mental Health- Main Corridor- 9" by 9" floor tile, white with black streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected with in the vinyl floor tile located within the office. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	104	Office	Sample Rep	B51-ASB.17	17-Nov-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Mental Health- Main Corridor- 9" by 9" floor tile, white with black streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected with in the vinyl floor tile located within the office. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	105	Office	Sample Rep	B51-ASB.17	17-Nov-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Mental Health- Main Corridor- 9" by 9" floor tile, white with black streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected with in the vinyl floor tile located within the office. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	106	Office	Sample Rep	B51-ASB.17	17-Nov-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Mental Health- Main Corridor- 9" by 9" floor tile, white with black streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected with in the vinyl floor tile located within the office. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	107	Office	Sample Rep	B51-ASB.17	17-Nov-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Mental Health- Main Corridor- 9" by 9" floor tile, white with black streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected with in the vinyl floor tile located within the office. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	

Mental Health Building			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
M	108	Office	Sample Rep	B51-ASB.17	17-Nov-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Mental Health- Main Corridor- 9" by 9" floor tile, white with black streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected with in the vinyl floor tile located within the office. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	109	Office	Sample Rep	B51-ASB.17	17-Nov-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Mental Health- Main Corridor- 9" by 9" floor tile, white with black streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected with in the vinyl floor tile located within the office. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	112	Office	Sample Rep	B51-ASB.17	17-Nov-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Mental Health- Main Corridor- 9" by 9" floor tile, white with black streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected with in the vinyl floor tile located within the office. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	113	Office	Sample Rep	B51-ASB.17	17-Nov-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Mental Health- Main Corridor- 9" by 9" floor tile, white with black streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected with in the vinyl floor tile located within the office. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	114	Office	Sample Rep	B51-ASB.17	17-Nov-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Mental Health- Main Corridor- 9" by 9" floor tile, white with black streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected with in the vinyl floor tile located within the office. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	115	Office	Sample Rep	B51-ASB.17	17-Nov-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Mental Health- Main Corridor- 9" by 9" floor tile, white with black streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected with in the vinyl floor tile located within the office. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	116	Office	Sample Rep	B51-ASB.17	17-Nov-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Mental Health- Main Corridor- 9" by 9" floor tile, white with black streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected with in the vinyl floor tile located within the office. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	117	Office	Sample Rep	B51-ASB.17	17-Nov-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Mental Health- Main Corridor- 9" by 9" floor tile, white with black streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected with in the vinyl floor tile located within the office. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M	118	Office	Sample	B51-ASB.20	17-Nov-12		None	Vinyl Floor Tile			Mental Health- Room 118- 12" by 12" floor tile, white with peach spec	No accessible ACM			No action required. No accessible asbestos-containing materials identified. Please note that there is a potential for asbestos to be present in concealed areas such as ceiling spaces, wall cavities and pipe chases located within the area.	
M		Auditorium Storage Room	Sample Rep	B51-ASB.17	17-Nov-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Mental Health- Main Corridor- 9" by 9" floor tile, white with black streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected with in the vinyl floor tile located within the storage room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Auditorium Sound Booth	Sample Rep	B51-ASB.17	17-Nov-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Mental Health- Main Corridor- 9" by 9" floor tile, white with black streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected with in the vinyl floor tile located within the south booth. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Medical Records Room	Sample	B51-ASB.18	17-Nov-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Mental Health- Medical Records Room- 9" by 9" floor tile, green with white streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected with in the vinyl floor tile located within the medical records room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	

Mental Health Building			BERSCH & ASSOCIATES LTD.													
			SAMPLE DATA													
Floor	Room Number	Use	SAMPLE SAMPLE REP	Sample ID	Date DD/MM/YY	Asbestos Type	% of Asbestos	Tradename ACM Product	Condition	Priority	Description of Sample Location	Asbestos Content In Area	Potential for Disturbance	Recommended Action	Comments	
M		Photocopier Room	Sample	B51-ASB.19	17-Nov-12	Chrysotile	1-5%	Vinyl Asbestos Tile	Good	3	Mental Health- Photocopier Room- 9" by 9" floor tile, blue with black streak	Vinyl Asbestos Tile	Low	Manage	Asbestos was detected with in the vinyl floor tile located within the photocopier room. Overall, this material was noted in good condition and may be managed in place until renovations warrant removal.	
M		Loading Dock Storage	Sample	B51-ASB.21	17-Nov-12	Chrysotile	60%	Pipeline Fitting Compound	Moderate	2	Mental Health- Loading Dock Storage- Pipeline fitting on small line, above head, adjacent unit heater	Pipeline Fitting Compound	Moderate	Repair	Repair exposed pipeline fitting above head, adjacent unit heater.	